

MITSUBISHI

NC-EDM SYSTEMS

EA SERIES


OPERATION MANUAL

CONTENT

BASIC OPERATION

MACHINING TECHNOLOGY

MACHINING EXAMPLES

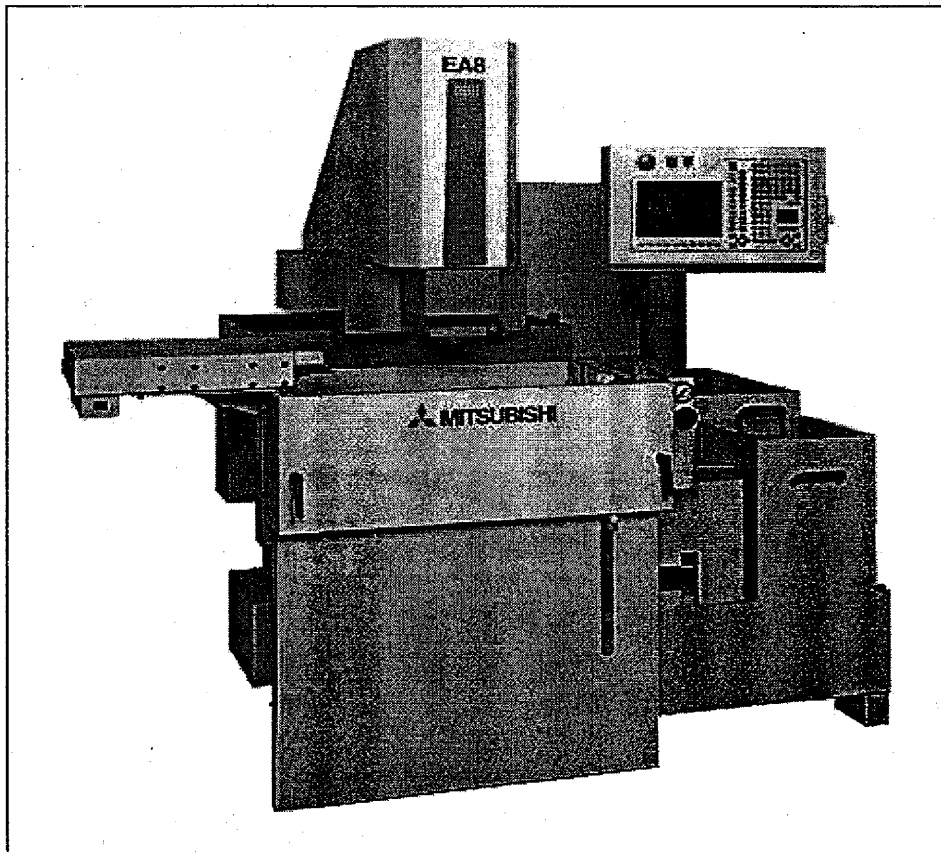

CONTENTS

1. Turning the Power ON and Starting Up the System	2-1
1.1 Turning the Power ON	2-1
1.2 Starting Up the System	2-2
2. General Operations before Machining	2-3
2.1 Zero Point Return Method	2-3
2.2 Direction of Each Axis Movement.....	2-3
2.3 Operation Methods of the Operation Panel	2-4
2.3.1 Each lamp and operation key	2-4
2.3.2 Basics of inputting data	2-8
3. Workpiece Setting and Positioning.....	2-16
3.1 Installation of Workpiece and Adjustment of Parallelism	2-16
3.2 Positioning with SET-UP Screen.....	2-16
3.3 Corner Positioning	2-17
3.4 Hole Positioning	2-18
3.5 Pole Positioning.....	2-18
3.6 Positioning of Workpiece to Electrode Using Manual Operation Box	2-19
3.7 Positioning with Steel Ball Using Manual Operation Box	2-19
3.8 Positioning with Reference Sphere Using NC Program	2-20
3.9 Types and Features of Positioning	2-21
3.10 Precautions for Positioning	2-21
3.11 Obtaining of Parallelism after Installation of Electrode.....	2-22
4. Adjustment of Dielectric Fluid Flow Rate	2-23
4.1 Opening and Closing of the Working Tank Door	2-23
4.2 Filling of Dielectric Fluid	2-24
4.3 Emission of Dielectric Fluid.....	2-24
4.4 Suction of Dielectric Fluid	2-24
4.5 Fluid Level Setting.....	2-25
4.6 Drain of Dielectric Fluid	2-26
4.7 Adjustment of dielectric fluid constant emission valve	2-26