


# YASNAC i80M

CNC SYSTEM FOR MACHINING CENTERS

## OPERATION MANUAL

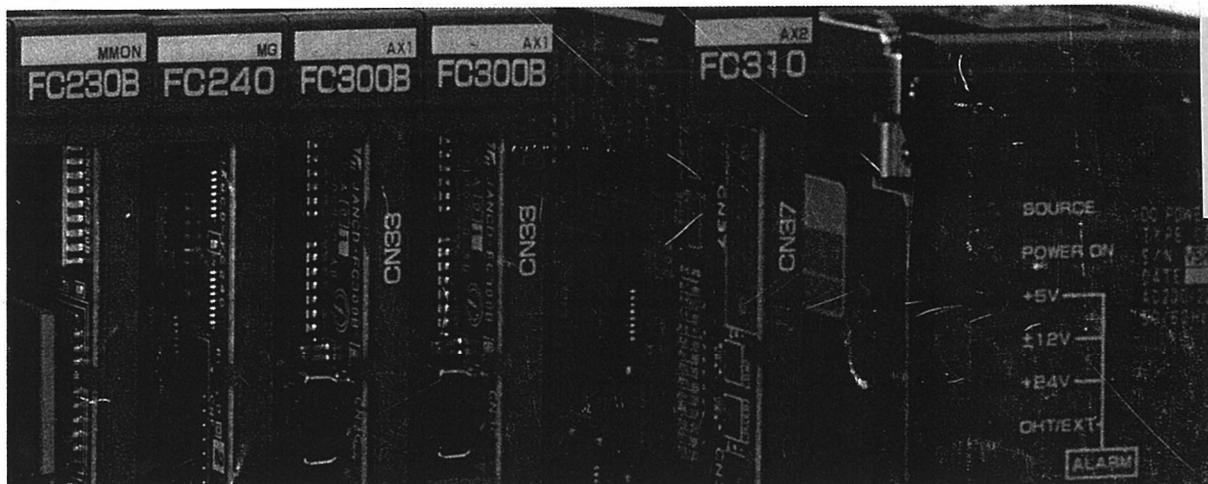

Before initial operation read these instructions thoroughly, and retain for future reference.



YASKAWA

CONTENTS

Page

|          |         |   |
|----------|---------|---|
| <b>1</b> | PREFACE | 1 |
|----------|---------|---|

---

|          |             |   |
|----------|-------------|---|
| <b>2</b> | PROGRAMMING | 9 |
|----------|-------------|---|

---

|          |                          |     |
|----------|--------------------------|-----|
| <b>3</b> | DESCRIPTION OF OPERATION | 325 |
|----------|--------------------------|-----|

---

|          |             |     |
|----------|-------------|-----|
| <b>4</b> | MAINTENANCE | 649 |
|----------|-------------|-----|

---

# CONTENTS


|  | Page |
|--|------|
| 1. PREFACE .....   | 1    |
| 1.1 BASIC CONFIGURATION OF NC MACHINE TOOL SYSTEM .....                    | 2    |
| 1.2 BASIC OPERATION .....  | 3    |
| <br>   |      |
| 2. PROGRAMMING .....   | 5    |
| 2.1 CONTROL AXES .....   | 7    |
| 2.1.1 Simultaneously Controllable Axes of Three-axis Control .....         | 9    |
| 2.1.2 Simultaneously Controllable Axes of 4th and 5th axes Control ※ ..... | 10   |
| 2.1.3 Least Input Increment and Least Output Increment .....               | 11   |
| 2.1.4 Maximum Move Command Values .....                                    | 12   |
| <br>   |      |
| 2.2 PROGRAMMING .....  | 13   |
| 2.2.1 Process Sheet .....  | 13   |
| 2.2.2 Programming Format .....   | 14   |
| 2.2.2.1 Label part .....   | 15   |
| 2.2.2.2 Tape start/ tape end .....   | 15   |
| 2.2.2.3 Program start/ program end .....                                   | 16   |
| 2.2.2.4 Program part .....   | 17   |
| 2.2.2.5 Comment part .....   | 25   |
| 2.2.3 Buffer Register and Multi-active Register .....                      | 27   |
| 2.2.4 Tape Code .....  | 28   |
| 2.2.5 NC TAPE .....  | 30   |
| <br>   |      |
| 2.3 PREPARATORY FUNCTION (G-FUNCTION) .....                                | 32   |
| <br>   |      |
| 2.4 INTERPOLATION .....  | 36   |
| 2.4.1 Positioning .....  | 36   |
| 2.4.1.1 Positioning (G00,G06) .....  | 36   |
| 2.4.1.2 Unidirectional approach (G60) ※ .....                              | 38   |
| 2.4.2 Linear Interpolation (G01) .....                                     | 39   |
| 2.4.3 Circular Interpolation (G02, G03) .....                              | 41   |
| 2.4.4 Helical Interpolation (G02, G03) ※ .....                             | 48   |
| <br>   |      |
| 2.5 FEED FUNCTIONS .....   | 50   |
| 2.5.1 Rapid Traverse Rate .....  | 50   |
| 2.5.2 Feed .....   | 51   |
| 2.5.3 F1-digit Feed ※ .....  | 54   |
| 2.5.4 Feedrate per Minute .....  | 56   |
| 2.5.5 Solid Tap Mode ※ .....   | 56   |
| 2.5.6 Automatic Acceleration and Deceleration .....                        | 57   |
| 2.5.6.1 Accel/decel of rapid traverse and manual feed .....                | 57   |
| 2.5.6.2 S-curve accel/decel ※ .....  | 57   |
| 2.5.6.3 Cutting feed accel/decel .....                                     | 59   |

## CONTENTS (Cont'd)

|   | Page    |
|---|---------|
| 2.5.7 Override .....  | 59      |
| 2.5.7.1 Feed rate override .....                                | 59      |
| 2.5.7.2 Rapid traverse rate override switch .....               | 60      |
| 2.5.8 Dwell (G04) .....   | 60      |
| 2.5.9 Speed control reference .....                             | 61      |
| 2.5.9.1 Exact stop (G09) .....                                  | 62      |
| 2.5.9.2 Exact stop mode (G61, G64) .....                        | 62      |
| <br>2.6 REFERENCE POINT RETURN .....                            | <br>63  |
| 2.6.1 Automatic Reference Point Return (G28) .....              | 63      |
| 2.6.2 Reference Point Return Check (G27) .....                  | 68      |
| 2.6.3 Return from Reference Point Return (G29) .....            | 69      |
| 2.6.4 Second to Fourth Reference Point Return (G30) * .....     | 72      |
| <br>2.7 COORDINATE SYSTEM .....                                 | <br>73  |
| 2.7.1 Types of Coordinate Systems (G54 to G59, *, G92) .....    | 73      |
| 2.7.1.1 Setting reference coordinate system by G92 .....        | 74      |
| 2.7.1.2 Setting work coordinate systems by G54-G59 * .....      | 75      |
| 2.7.1.3 Local coordinate system (G52) * .....                   | 81      |
| 2.7.1.4 Machine coordinate system (G53) .....                   | 83      |
| 2.7.1.5 Rotation of work coordinate system * .....              | 85      |
| 2.7.2 Plane Selection (G17/G18/G19) .....                       | 87      |
| <br>2.8 ENTERING COORDINATE VALUES .....                        | <br>88  |
| 2.8.1 Absolute/incremental Specification (G90, G91) .....       | 88      |
| 2.8.2 Inch/metric Input Specification (G20, G21) * .....        | 90      |
| 2.8.3 Decimal Point Input .....                                 | 92      |
| 2.8.4 Scaling (G50, G51) * .....                                | 93      |
| 2.8.5 Coordinate Rotation (G68, G69) * .....                    | 96      |
| <br>2.9 SPINDLE FUNCTION (S FUNCTION) .....                     | <br>98  |
| 2.9.1 Spindle Command .....                                     | 98      |
| <br>2.10 TOOL FUNCTION (T FUNCTION) .....                       | <br>99  |
| 2.10.1 Tool Select Command .....                                | 99      |
| 2.10.1.1 T2-digit specification .....                           | 99      |
| 2.10.1.2 T4-digit specification * .....                         | 99      |
| <br>2.11 AUXILIARY FUNCTION (M FUNCTION) .....                  | <br>100 |
| 2.11.1 M Function .....   | 100     |
| 2.11.1.1 M codes related to stopping (M00, M01, M02, M30) ..... | 100     |
| 2.11.1.2 Internal processing M codes .....                      | 101     |

|   | Page |
|---|------|
| 2.11.1.3 Other M codes .....  | 102  |
| 2.11.2 Secondary Auxiliary Function (B Function) ※ .....                                  | 103  |
| <br>  |      |
| 2.12 TOOL OFFSET .....  | 104  |
| 2.12.1 Tool Offset Amount .....   | 105  |
| 2.12.1.1 Tool offset value memory .....   | 105  |
| 2.12.1.2 H and D functions (H, D codes) .....   | 106  |
| 2.12.2 Tool Length Offset (G43/G44/G49) .....   | 108  |
| 2.12.3 Tool Position Offset (G45-G48) .....   | 111  |
| 2.12.4 Tool Radius Offset-C (G40, G41, G42) ※ .....                                       | 121  |
| 2.12.5 Multiactive Registers (M92/M93) ※ .....  | 161  |
| 2.12.6 Internal M Codes for Round-the-arc Discrimination (M96/M97) .....                  | 162  |
| <br>  |      |
| 2.13 PROGRAM SUPPORT FUNCTIONS .....  | 163  |
| 2.13.1 Canned Cycles ※ .....  | 163  |
| 2.13.1.1 Canned cycles .....  | 163  |
| 2.13.1.2 Solid tap function ※ .....   | 189  |
| 2.13.2 Hole-opening Pattern Cycle (G70, G71, G72) ※ .....                                 | 197  |
| 2.13.3 Circle Cutting (G12, G13) ※ .....  | 201  |
| 2.13.4 Mirror Image ON/OFF (M95/M94) ※ .....  | 206  |
| 2.13.5 Programmable Date Input (G10) ※ .....  | 210  |
| 2.13.6 Program Call Functions .....   | 213  |
| 2.13.6.1 Subprogram call (M98/M99) .....  | 213  |
| 2.13.6.2 Program copy (G25) ※ .....   | 216  |
| 2.13.6.3 Macroprogram call (G65, G66, G67) ※ .....  | 219  |
| 2.13.7 Auto Corner Override (G106) ※ .....  | 220  |
| 2.13.8 Stored Stroke Limit Check .....  | 225  |
| 2.13.8.1 Stored stroke limit ※ .....  | 225  |
| 2.13.8.2 Stroke limits B.C ※ .....  | 226  |
| 2.13.9 Comment Statement Output (M191) ※ .....  | 230  |
| 2.13.10 Break Point .....   | 230  |
| 2.13.11 High-speed Cutting (Available only when expansion CPU option is provided) ※ ..... | 231  |
| <br>  |      |
| 2.14 MACROPROGRAM (G65, G66, G67) ※ .....   | 234  |
| 2.14.1 Macroprogram Call .....  | 236  |
| 2.14.1.1 Multiplexed macro call .....   | 242  |
| 2.14.1.2 Argument specification .....   | 244  |
| 2.14.2 Variables .....  | 248  |
| 2.14.3 Expression of Variables .....  | 276  |
| 2.14.4 Quoting Variables .....  | 277  |

## CONTENTS (Cont'd)

|  | Page |
|--|------|
| 2.14.5 Undefined Variables .....   | 279  |
| 2.14.6 Arithmetic Commands .....   | 280  |
| 2.14.7 Control Commands .....  | 283  |
| 2.14.8 Entering Macroprograms .....  | 290  |
| 2.14.9 RS-232C Data Output-2 (BPRNT, DPRNT) .....  | 291  |
| 2.14.10 Alarm Nos. of Macroprogram .....   | 296  |
| 2.14.11 Macroprogram Examples .....  | 297  |
| <br>   |      |
| 2.15 AUTOMATIC MEASURING FUNCTION .....  | 309  |
| 2.15.1 Skip Function (G31) ※ .....   | 309  |
| 2.15.2 Program Interrupt Function ON/OFF (M91, M90) ※ .....  | 312  |
| 2.15.3 Tool Life Control ※ .....   | 315  |
| <br>   |      |
| 3 DESCRIPTION OF OPERATION .....   | 325  |
| 3.1 DISPLAY .....  | 326  |
| <br>   |      |
| 3.2 STRUCTURE OF PROCESS, JOB AND FUNCTION .....   | 327  |
| <br>   |      |
| 3.3 NC OPERATOR PANEL AND DISPLAY SCREEN .....   | 331  |
| 3.3.1 Functions of NC Operator Panel Keys .....  | 331  |
| 3.3.1.1 Power ON/OFF buttons .....   | 331  |
| 3.3.1.2 9-inch graphic display .....   | 332  |
| 3.3.1.3 Process keys .....   | 332  |
| 3.3.1.4 Soft keys .....  | 333  |
| 3.3.1.5 Address keys .....   | 334  |
| 3.3.1.6 Deta keys .....  | 334  |
| 3.3.1.7 Page keys .....  | 335  |
| 3.3.1.8 Cursor keys .....  | 335  |
| 3.3.1.9 Action keys .....  | 336  |
| 3.3.1.10 Reset key .....   | 337  |
| 3.3.1.11 Auxilliary key .....  | 337  |
| <br>   |      |
| 3.4 DISPLAY AND WRITING .....  | 338  |
| 3.4.1 Constant Display .....   | 338  |
| 3.4.2 Pop-up Menu .....  | 342  |
| 3.4.3 Key Buffer Edit Function .....   | 344  |
| 3.4.4 Buzzer Function .....  | 345  |
| 3.4.5  (Program Edition) Process .....    | 346  |
| 3.4.5.1 Part Program editing .....   | 346  |
| 3.4.5.2 Part Program list job .....  | 376  |
| 3.4.5.3 Part Program I/O Verification .....  | 392  |
| 3.4.5.4 Program path drawing job  ※ ..... | 419  |
| 3.4.6 Setup Process  .....                | 443  |

|   | Page |
|---|------|
| 3.4.6.1 Work coordinate system job .....  | 444  |
| 3.4.6.2 Tool job .....  | 450  |
| 3.4.6.3 Tool life control job .....   | 469  |
| 3.4.7 Run Process  .....         | 479  |
| 3.4.7.1 Program job .....   | 480  |
| 3.4.7.2 Command value job .....   | 495  |
| 3.4.7.3 Setting job .....   | 496  |
| 3.4.7.4 NC path drawing job ※ .....   | 506  |
| 3.4.8 Maintenance Process  ..... | 516  |
| 3.4.8.1 Parameter job .....   | 518  |
| 3.4.8.2 I/O monitor job .....   | 524  |
| 3.4.8.3 I/O verification job .....  | 530  |
| 3.4.8.4 Internal information job .....  | 536  |
| 3.4.9 Common Process (  ) .....  | 540  |
| 3.4.9.1 Current value job .....   | 541  |
| 3.4.9.2 Alarm job .....   | 549  |
| 3.4.9.3 Time job .....  | 552  |
| <br>  |      |
| 3.5 MACHINE CONTROL STATION .....   | 557  |
| 3.5.1 Switching Units on Machine Control Station .....  | 557  |
| 3.5.1.1 Mode Select Switch (MODE SELECT) .....  | 558  |
| 3.5.1.2 Cycle Start Key and Lamp (CYCLE START) .....  | 559  |
| 3.5.1.3 Feed Hold Key and Lamp (FEED HOLD) .....  | 559  |
| 3.5.1.4 Emergency Stop Switch (EMERGENCY STOP) .....  | 560  |
| 3.5.1.5 Simultaneous One-axis Control, Manual Pulse Generator (HANDLE) ※ .....                                    | 561  |
| 3.5.1.6 Handle axis select switch (HANDLE AXIS SELECT) ※ .....  | 561  |
| 3.5.1.7 Manual feed pulse multiply select switch (MANUAL PULSE MULTIPLY) .....                                    | 562  |
| 3.5.1.8 Simultaneous 3-axis Control, Manual Pulse Generator (HANDLES) ※ .....                                     | 563  |
| 3.5.1.9 Manual Feed keys (JOG) .....  | 564  |
| 3.5.1.10 Jog Feedrate Select Switch (JOG FEEDRATE) .....  | 565  |
| 3.5.1.11 Rapid Feedrate Override Select Switch (RAPID TRAVERSE RATE OVERRIDE) .....                               | 566  |
| 3.5.1.12 Feedrate Override Select Switch (FEEDRATE OVERRIDE) .....  | 567  |
| 3.5.1.13 JOG Feedrate Override Select Switch (JOG FEEDRATE OVERRIDE) ※ .....                                      | 568  |
| 3.5.1.14 Feedrate Override Cancel Switch (FEEDRATE OVERRIDE CANCEL) .....   | 568  |
| 3.5.1.15 Spindle Speed Override Switch (SPINDLE-SPEED OVERRIDE) ※ .....   | 569  |
| 3.5.1.16 Manual Reference Point Return Switch (MANUAL REFERENCE POINT RETURN) ※ .....                             | 569  |
| 3.5.1.17 Reference Point Position Lamp (REFERENCE POINT) ※ .....  | 569  |
| 3.5.1.18 Single-Block Switch (SINGLE-BLOCK) .....   | 570  |
| 3.5.1.19 Optional Stop (OPTIONAL STOP) .....  | 570  |
| 3.5.1.20 Optional block Skip Switch (OPTIONAL BLOCK SKIP) .....   | 571  |
| 3.5.1.21 Dry Run Switch (DRY RUN) .....   | 572  |
| 3.5.1.22 Display Lock/machine Lock Switch (DISPLAY LOCK/MACHINE LOCK) .....                                       | 573  |

## CONTENTS (Cont'd)

|  | Page    |
|--|---------|
| 3.5.1.23 Z-axis Command Cancel Switch (Z-AXIS COMMAND DISREGARD) .....                       | 573     |
| 3.5.1.24 4th-axis Disregard Input .....  | 574     |
| 3.5.1.25 5th-axis Disregard Input .....  | 574     |
| 3.5.1.26 Auxiliary function lock switch (AUXILIARY FUNCTION LOCK) .....                      | 575     |
| 3.5.1.27 Manual Absolute Switch (MANUAL ABSOLUTE) .....                                      | 576     |
| 3.5.1.28 Mirror Image Axis Specification Switch (MIRROR IMAGE AXIS) .....                    | 578     |
| 3.5.1.29 Tool Length Measurement Key and Lamp* .....   | 578     |
| 3.5.1.30 Start Lock Switch (START LOCK) * .....  | 579     |
| 3.5.1.31 Edit Lock Switch (EDIT LOCK) * .....  | 579     |
| 3.5.1.32 Interlock Input (INTERLOCK) .....   | 580     |
| 3.5.1.33 External Deceleration Input (EXTERNAL DECELERATION) * .....                         | 580     |
| 3.5.2 Operation Procedure .....  | 582     |
| 3.5.2.1 Before Turning Power On .....  | 583     |
| 3.5.2.2 Power On .....   | 583     |
| 3.5.2.3 Manual Operation .....   | 585     |
| 3.5.2.4 Compensation of Stored Type Pitch Error and Preparation of Stored Stroke Limit ..... | 587     |
| 3.5.2.5 Preparation for Automatic Operation .....  | 588     |
| 3.5.2.6 Memory Operation .....   | 590     |
| 3.5.2.7 Intervening with Manual Operation during Automatic Operation .....                   | 592     |
| 3.5.2.8 Automatic Operation with MDI .....   | 593     |
| 3.5.2.9 Intervening with MDI Operation during Automatic Operation .....                      | 593     |
| 3.5.2.10 Preparation Prior to Power OFF and during Power OFF Operation .....                 | 594     |
| <br>3.6 VARIOUS OPERATIONS AND FUNCTIONS .....   | <br>595 |
| 3.6.1 Reference Point Return Operation .....   | 595     |
| 3.6.1.1 Manual reference point return .....  | 595     |
| 3.6.1.2 Easy return to reference point * .....   | 598     |
| 3.6.1.3 2nd manual reference point return * .....  | 603     |
| 3.6.2 Coordinate System Setting Operation .....  | 604     |
| 3.6.2.1 Automatic coordinate system setting .....  | 604     |
| 3.6.3 Handle Operation .....   | 605     |
| 3.6.3.1 Simultaneous 2nd and 3rd handle axis feed * .....                                    | 605     |
| 3.6.3.2 AUTO mode handle offset * .....  | 606     |
| 3.6.4 Spindle Indexing Function* .....   | 608     |
| 3.6.5 Return to Suspended Operation Point * .....  | 609     |
| 3.6.6 Tool Length Measurement * .....  | 611     |
| 3.6.7 Manual Skip * .....  | 616     |
| 3.6.8 Manual Centering * .....   | 619     |
| 3.6.9 Playback* .....  | 621     |
| 3.6.10 Program Restart * .....   | 624     |
| 3.6.11 Machine and Servo Systems Correction Function .....                                   | 630     |
| 3.6.11.1 Backlash correction .....   | 630     |
| 3.6.11.2 Pitch error compensation * .....  | 631     |

|   | Page |
|---|------|
| 4 MAINTENANCE .....   | 643  |
| 4.1 ROUTINE MAINTENANCE .....                               | 645  |
| 4.1.1 Control Panel Maintenance .....                       | 645  |
| 4.1.2 Maintenance of the Servomotor and Spindle Motor ..... | 646  |
| 4.1.3 Battery Check .....                                   | 646  |
| 4.2 BATTERY REPLACEMENT .....                               | 647  |
| 4.3 POWER SUPPLY .....                                      | 649  |
| 4.4 SERVO CONTROL UNIT ALARM AND CORRECTIVE ACTION .....    | 650  |
| 4.5 MCCB (WIRING CIRCUIT BREAKER) .....                     | 652  |
| 4.6 CAUSE OF FAULTS AND CORRECTIVE ACTION .....             | 653  |
| 4.6.1 On-line Self-diagnosis .....                          | 653  |
| 4.6.2 Cause due to alarm code, and corrective action. ....  | 653  |
| 4.6.3 I/O Signal Diagnosis .....                            | 654  |