


# **LC30** CNC LATHE WITH OSP5000L CNC SYSTEM

---

---

## **OPERATION & MAINTENANCE MANUAL**

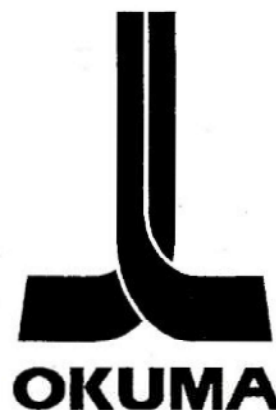

OPERATION AND MAINTENANCE  
for LC30 CNC LATHE

Publication NO.: 2146-E

## TABLE OF CONTENTS

	Page
<b>SECTION 1 INTRODUCING YOUR NC LATHE</b> .....	1
<b>SECTION 2 MACHINE SPECIFICATIONS</b> .....	2
2-1 Specifications Table .....	2
2-2 Specifications Diagram .....	4
<b>SECTION 3 MACHINE OPERATION</b> .....	11
3-1 NC Operation .....	12
3-2 Machine Operation .....	13
<b>SECTION 4 MAINTAINING YOUR NC LATHE IN THE BEST CONDITION – REGULAR INSPECTION AND MAINTENANCE OF MACHINE</b> .....	28
4-1 Lubrication .....	30
4-2 Cleaning the Filter .....	39
4-3 Tensioning Belts .....	40
4-4 Adjustment of Turret Index Speed .....	43
4-5 Check the Bed Level .....	45
4-6 Alignment of Headstock .....	45
4-7 Adjustment of Tapered Gibs .....	46
4-8 Tailstock Alignment .....	47
4-9 Cleaning Pulse Feed Handwheel .....	48
4-10 Cleaning Coolant Tank .....	49
4-11 Servicing DC Main Motor .....	50
<b>SECTION 5 HANDLING AND INSTALLATION OF MACHINE</b> .....	51
5-1 Care in Handling a Precision Machine .....	51
5-2 Foundation Requirements .....	54
5-3 General Procedure for Installation .....	54
5-4 Levelling the Machine .....	56
5-5 Power Requirements .....	57
5-6 Floor Plan .....	58
5-7 Foundation Plan .....	59
<b>SECTION 6 SPARE PARTS LIST</b> .....	60
6-1 Hydraulics .....	60
6-2 Electricals (on Machine) .....	61
6-3 CONSUMABLE ITEMS .....	62
<b>SECTION 7 TECHNICAL DATA</b> .....	64
7-1 Turret .....	64

7-2	Working Range .....	71
7-3	Dimensions of Spindle Nose .....	75
7-4	Installation of Standard Chuck .....	76
7-5	Hydraulic Tailstock .....	78
7-6	Hydraulic Circuit Diagram .....	79

**SECTION 8 TROUBLESHOOTING FOR SIMPLE MECHANICAL TROUBLE .....**

8-1	Machine does not Turn on .....	80
8-2	Trouble in Headstock .....	81
8-3	Turret .....	82
8-4	Others .....	82

MAINTENANCE  
for OSP5000L CNC SYSTEM

Publication NO.: 2196-E

## TABLE OF CONTENTS

	Page
<b>SECTION 1 MAIN FEATURES OF OSP5000L SERIES .....</b>	<b>1</b>
<b>SECTION 2 SUMMARY OF NC OPERATION .....</b>	<b>2</b>
<b>SECTION 3 CONSTRUCTION OF OSP 5000L CNC SYSTEM .....</b>	<b>3</b>
3-1 CPU and Power Supply Unit .....	3
3-2 Servo Drive Units .....	3
3-3 Relay and Magnetic Panels .....	3
3-4 Spindle Drive DC Motor Control Unit .....	4
3-5 Control Enclosure .....	4
3-6 Operation Panel .....	4
3-7 Absolute Position Feedback Encoders .....	4
3-8 Cooling Unit .....	4
<b>SECTION 4 INSPECTION AND MAINTENANCE .....</b>	<b>5</b>
4-1 Inspection of Installation Site .....	5
4-1-1 Installation Site .....	5
4-1-2 Environmental Requirements .....	5
4-1-3 Inspecting Shop Power Supply .....	6
4-2 Periodical Maintenance .....	6
4-3 Operation and Construction of CNC System .....	7
4-3-1 Example of System Operation .....	7
4-3-2 General Description of Major System Components ...	8
4-4 Self-Diagnostic Function .....	10
4-4-1 Alarm and Error Display .....	10
4-4-2 Check Data Display .....	11
<b>SECTION 5 TROUBLE AND TROUBLESHOOTING .....</b>	<b>20</b>
5-1 Basic Troubleshooting Procedure .....	20
5-2 Machine-Mounted Electricals .....	22
5-2-1 Limit-Switches .....	22
5-2-2 Rotary Switches (Testing by Self-Diagnostic Function) .....	23
5-3 Servo Drive Units .....	23
5-3-1 Operation and Construction of the Servo Drive Unit .....	23
5-3-2 Inspection of Servo Drive Units .....	24
5-3-3 Inspection of the Commutator Brushes of DC Servo Motors .....	27
5-4 Inspection of OSP Position Encoders .....	28
5-5 Central Processing Unit (CPU) .....	29
5-5-1 Operation and Construction .....	29

	Page	
5-5-2	Checking CPU Operation .....	31
5-5-3	Control Tape Loading .....	32
5-5-4	CPU Power Supply Unit .....	34
5-6	Relay and Magnetics Circuits .....	35
5-6-1	Operation and Construction .....	36
5-6-2	Inspection of Relays and Magnetics .....	36
5-6-3	Inspection of Multi-Circuit Pin Connectors .....	41
<b>SECTION 6</b>	<b>SPINDLE DRIVE UNIT FOR DC MOTOR – SDU-600W SERIES</b> .....	<b>42</b>
6-1	General Description .....	42
6-2	Alarm Conditions and Display of SDU-600 W Series Unit .....	44
6-2-1	Alarm Display and Contents .....	44
6-2-2	Resetting of Alarm Condition, Replacement of Blown Fuses and Resetting of Non-Fused Circuit Breaker .....	45
6-3	Construction of SDU-600W Series Spindle Drive Unit .....	47
6-3-1	Layout of Component Parts .....	47
6-3-2	Principle Functions .....	49
6-4	Spare and Replacement Parts .....	50
6-4-1	Spare and Replacement Parts of SDU-600-W .....	50
6-4-2	Spare and Replacement Parts for DC Motor and Tachogenerator .....	51
6-5	Inspection and Maintenance of DC motor and Tachogenerator .....	52
6-5-1	Inspection and Maintenance of Brushes .....	52
6-5-2	Inspection and Maintenance of Bearings .....	52
6-5-3	Inspection and Maintenance of Air Filter .....	52
6-6	Troubleshooting Chart .....	53
<b>SECTION 7</b>	<b>COOLING UNIT</b> .....	<b>54</b>
7-1	Inspection and Maintenance .....	54
<b>SECTION 8</b>	<b>SPARE PARTS LIST</b> .....	<b>55</b>
8-1	Spare Parts for Model LC10 with OSP 5000L .....	55
8-2	Spare Parts for Model LC20 with OSP 5000L .....	56
8-3	Spare Parts for Model LC30 with OSP 5000L .....	57
8-4	Spare Parts for Model LC40 with OSP 5000L .....	58
8-5	Spare Parts for Model LC-50/1S (37/45 kW) with OSP 5000L ..	59
8-6	Spare Parts for Model LC-50/2S (45/55 kW) with OSP 5000L ..	60
8-7	Spare Parts for Model LS30-N (11/15 kW) with OSP 5000L ...	61
8-8	Spare Parts for Model LH35-N (15/22 kW) with OSP 5000L ...	62
8-9	Spare Parts for Model LH50-N (37/45 kW) with OSP 5000L ...	63



Fig. 1-18	Internal Layout of OSP5000L CNC Unit (LH35-N) .....	170
Fig. 1-19	Internal Layout of OSP5000L CNC Unit (LH50-N) .....	171
Fig. 1-20	Table of Power Requirements for Model LC10/20/30/40 200/220 V .....	172
Fig. 1-21	Table of Power Requirements for Model LC50 200/220 V .....	173
Fig. 1-22	Table of Power Requirements for LS30-N, LH-N 200/220 V .....	174