

TANSHING®

OPERATION, MAINTENANCE MANUAL

For


MRNC-255

MRNC-320

MRNC-400

Tanshing Professional CNC

Rotary Table Manufacturer

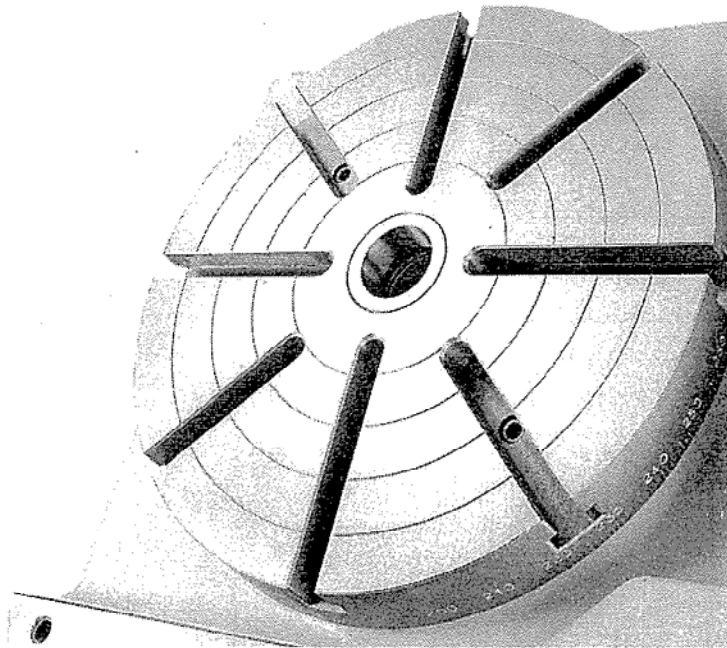

TANSHING ACCURATE IND. CO., LTD.

<http://www.tanshing.com.tw>
NO.1-1, LANE 165, SEC.1, TANSHING RD.
TANTZU HSIANG, TAICHUNG HSIEN,
427 TAIWAN, R.O.C.

Email: tanshing@ms16.hinet.net
TEL: +886-4-5384978
FAX: +886-4-5384980

CONTENTS

1.	INTRODUCTION	1
2.	SPECIFICATIONS	2
3.	INTRODUCTION OF NC ROTARY	3
	OUTLINE OF MECHANISM.....	3
	3.2. FEATURES OF NC ROTARY TABLE.....	4
4.	PREPARATION	5
	4.1. UNPACKING, MOVING THE TABLE TO THE SITE AND SETTING UP ONTO THE MACHINE TOOL	6
	4.2. LUBRICATION (SEE FIG. 2).....	7
	4.3. FEEDING OIL PRESSURE FOR TABLE CLAMPING AND DEAERATION (SEE FIG.3).....	9
	4.3.1. <i>Hydraulic clamping system (See Fig. 3 and 10)</i>	9
	4.3.2. <i>Air-hydro clamping system</i>	10
	4.4. TEST RUN AND ACCURACY CHECK:.....	11
	4.5. SETTING AMOUNT OF GRID SHIFT OF ZERO RETURN.....	12
	4.6. COMMAND TAPE PREPARATION.....	13
	4.7. WORK AND TOOL LOADING.....	13
5.	ROUTINE INSPECTION	14
	[EXAMPLE OF PROGRAMMING].....	15
6.	MECHANISM, MAINTENANCE AND ADJUSTMENT OF MAJOR COMPONENTS	16
	6.1. WORM GEAR BACKLASH ADJUSTMENT.....	16
	6.1.1. <i>Backlash adjustment (see Fig.6)</i>	17
	6.1.2. <i>Preparations for backlash adjustment (see Fig. 2 and 8)</i>	18
	6.1.3. <i>Backlash adjustment (See Fig. 7)</i>	19
	6.1.4. <i>Z1 gear position adjustment (See Fig. 9)</i>	20
	6.2. BACKLASH ADJUSTMENT OF GEARS IN GEAR CASE.....	21
	6.2.1. <i>Backlash between Z1 and Z2 gears (See Fig. 9)</i>	21
	6.2.2. <i>Backlash between Z3 and Z4 gears (see Fig.9)</i>	25
	6.3. CLAMPING DEVICE AND TABLE CLAMP/UNCLAMP LIMIT SWITCH UNIT (SEE FIG. 10 AND 11)	26
	6.3.1. <i>Clamping device structure (See Fig.10)</i>	26
	6.3.2. <i>Table clamp/unclamp limit switch unit (See Fig. 11)</i>	27
	6.4. ZERO RETURN LIMIT SWITCH UNIT STRUCTURE – DOG ADJUSTMENT (SEE FIG. 12 AND 13)	28
	6.4.1. <i>Zero Return limit switch unit (See Fig.12)</i>	28
	6.4.2. <i>Dog position adjustment</i>	28

TANSHING®

7. TROUBLE SHOOTING	31
8. REFERENCE	34
8.1. ANGLE-ARC LENGTH CONVERSION	34
8.2. NC COMMAND TAPE PREPARATION EXAMPLE	35