

Interactive Manual Data Input Function

# **ONE-TOUCH IGF**

---

---

---

OSP5020L CNC SYSTEM

---

**OPERATION GUIDE** (3rd Edition)


TABLE OF CONTENTS

	<u>PAGE</u>
SECTION 1 ONE-TOUCH IGF OPERATION .....	1
1. Machining Method Definition .....	1
2. Three Operation Procedures .....	3
3. Changing the Automatic Determination Rule .....	5
4. Tool Data and Prior Tool Designation .....	8
5. Material Data .....	10
6. Process Determination Conditions and Parameter Setting .....	11
7. Machining Shape and Blank Material Shape in the Machining Process .....	13
 SECTION 2 ONE-TOUCH IGF OPERATION EXAMPLES .....	 14
1. Example 1 (two-touch course) .....	16
2. Example 2 (two-touch course) .....	22
3. Example 3 (two-touch course) .....	28
4. Example 4 (two-touch course) .....	35
5. Example 5 (two-touch course) .....	43
6. Example 6 (two-touch course) .....	52
7. Example 7 (two-touch course) .....	59
8. Example 8 (two-touch course) .....	68
9. Example 9 (IGF course) .....	75
10. Example 10 (two-touch course: two-saddle specification) .....	85
11. Example 11 (two-touch course: two-saddle specification) .....	92
12. Supplement (Part Program Output Example) .....	105


SECTION 3 HOW TO USE PROCESS DETERMINATION CONDITIONS ..... 110

1. Prior Tool Designation ..... 113


(1) When Tools with Different Tool Angle and Edge Angle are Registered ..... 115

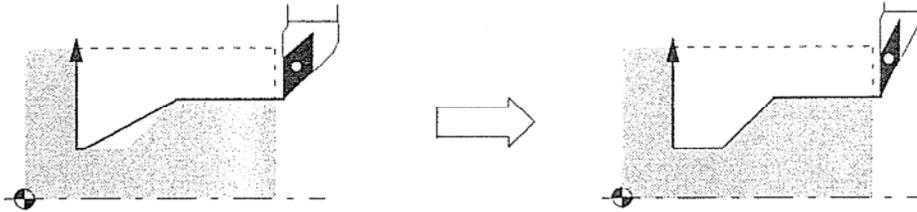


(2) When Tools with Different Holder Diameter are Registered ..... 116

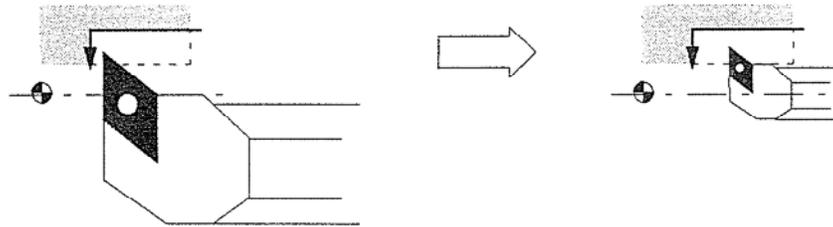

(3) When Tools with Different Tool Width are Registered ..... 117

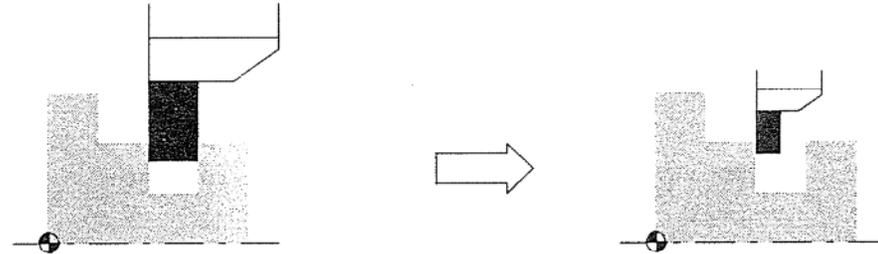


(4) When Drills with Different Drill Diameter are Registered ..... 118

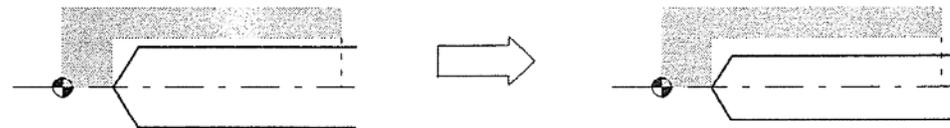


	<u>PAGE</u>
2. FACE/LONG DECIDING DATA .....	119
(1) Changing From LONG to FACE in the Roughing Cycle .....	120
(2) Changing From FACE to LONG in the Roughing Cycle .....	122
(3) Process Division in the Roughing Cycle (LONG → FACE + LONG) .....	123
(4) Process Division in the Roughing Cycle (FACE → FACE + LONG) .....	125
(5) Process Integration in the Roughing Cycle (FACE + LONG → LONG) .....	126
(6) Process Integration in the Roughing Cycle (FACE + LONG → FACE) .....	127

PAGE


- (7) Changing From LONG to FACE in the Finishing Cycle ..... 128

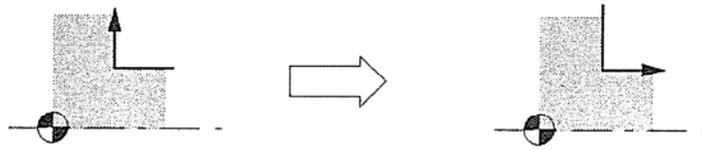


- (8) Changing From FACE to LONG in the Finishing Cycle ..... 130

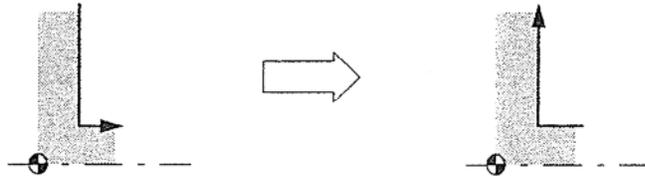


- (9) Process Division in the Finishing Cycle (FACE → FACE + LONG) ..... 131

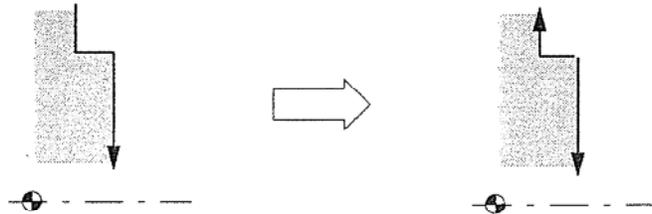

- (10) Process Integration in the Finishing Cycle (FACE + LONG → LONG) ..... 132






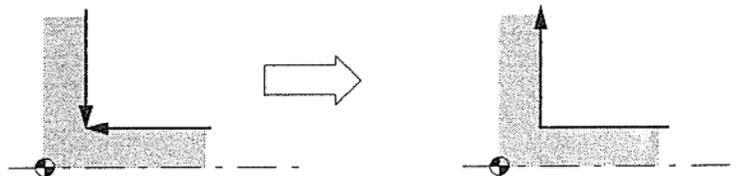


- (11) Process Integration in the Roughing Cycle (FACE + LONG → FACE) ..... 133

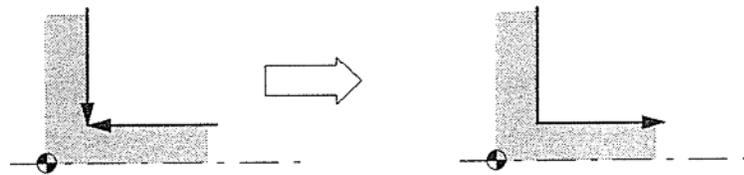

- (12) To Carry Out Single-process Machining Either by a Longitudinal Machining Process or by an End Face Machining Process ..... 134

- To always select a longitudinal machining process for the roughing process
- To always select an end face machining process for the roughing process
- To always select a longitudinal machining process for the finishing process
- To always select an end face machining process for the finishing process

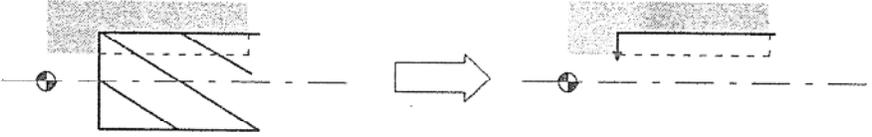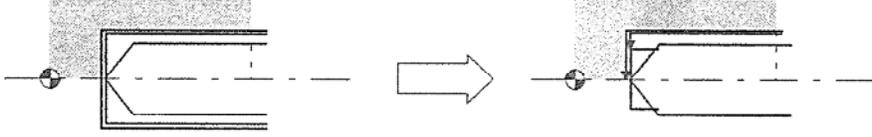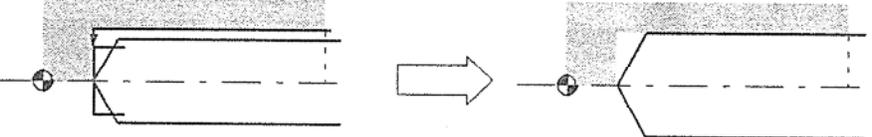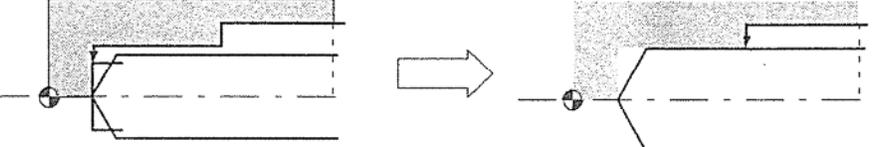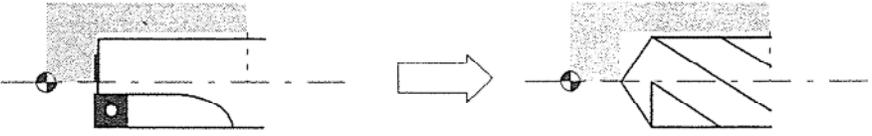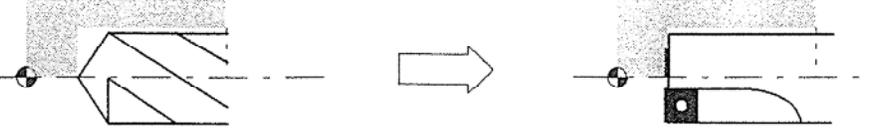	<u>PAGE</u>
3. Inside Machining Data .....	140
(1) Changing the Tool to be Used from an Endmill to a Boring Bar for Through-hole Machining .....	141
	
(2) Changing the Tool to be Used from an Endmill to a Boring Bar for Blind-hole Machining .....	142
	
(3) ID Machining Using Only a Drill (no other machining process than drilling) ...	143
	
(4) ID Machining Using Only a Drill (other machining process is carried out in addition to drilling for ID machining) .....	144
	
(5) Changing the Type of Drill (carbide drill → HSS drill) .....	145
	
(6) Changing the Type of Drill (HSS drill → carbide drill) .....	146
	

	<u>PAGE</u>
(7) To Machine the Workpiece Using either Only a Carbide Drill or Only a HSS drill .....	147
(8) Changing the Centering Tool .....	148
(9) Designating Whether or not Centering is Carried Out (HSS drill: with centering → HSS drill: without centering) .....	149
(10) Designating Whether or not Centering is Carried Out (carbide drill: without centering → HSS drill: with centering) .....	150
(11) Designating Whether or Not Centering is Always Carried out .....	151
(12) Designating Whether or not Drilling is Omitted .....	152
(13) Changing from Drilling to ROUGH O. FACE ↓ .....	153

	<u>PAGE</u>
(14) Mechanism to Determine that a Boring Bar can not be Used for Machining . . .	154
(15) Mechanism to Determine the Drill Diameter . . . . .	155
(16) Mechanism to Determine the Type of Drill . . . . .	156
(17) Mechanism to Determine Whether or not Centering is Executed . . . . .	157
(18) Mechanism to Omit Drilling . . . . .	158
4. Shape/Tool Position Data . . . . .	159
(1) Variation of Automatic Process Determination Output According to the Setting at ROUGH SHAPE OUTPUT(0 = OFFSET, 1 = SHIFT) (machining shape in the roughing process) . . . . .	161
(2) Variation of Automatic Process Determination Output According to the Setting at ROUGH SHAPE OUTPUT(0 = OFFSET, 1 = SHIFT) (surface roughness) . . . . .	163
(3) Variation of Automatic Process Determination Output According to the Setting at ROUGH SHAPE OUTPUT(0 = OFFSET, 1 = SHIFT) . . . . .	165
SECTION 4 QUESTIONS AND ANSWERS TO THE ONE-TOUCH IGF . . . . .	166
Q1 : What must be checked before beginning with actual machining? . . . . .	166
Q2 : The “chucking impossible” error occurs when automatic process determination is attempted. . . . .	169
Q3 : The “remained uncut area” error occurs when automatic process determination is attempted. . . . .	171
Q4 : Is it possible to cut the descending portion without using a tool for reverse-direction cutting? . . . . .	174
Q5 : The tool registered as tool data cannot be selected. . . . .	179
Q6 : Is it possible to recess the workpiece in the OD turning process (ROUGH OD←. FIN. OD←, etc.)? . . . . .	182
Q7 : Is it possible to carry out drilling after the ROUGH O.FACE ↓ process? (changing the machining sequence by changing the machining sequence parameter) . . . . .	184
Q8 : Points to be taken care of in the finishing process when the final shape has a very small step. . . . .	186
Q9 : How can cutoff be executed? . . . . .	187
Q10: Is there any problem when grooving the stepped shape? . . . . .	192

	<u>PAGE</u>
Q11: Is it possible to cut the workpiece using a straight tool? .....	195
Q12: Is it possible to cut the workpiece using a button tool? .....	196
Q13: What is the “cutting position (CUT PT CP)”? .....	198
Q14: What is the clearance set at the dimension parameter? .....	199
Q15: Is it possible not to retract the tool in the X-axis positive direction during approaching and retracting motions in the ID longitudinal machining processes (ROUGH ID← and FIN. ID←)? .....	200
Q16: How to cut the single groove, wide groove, or V-groove. ....	203
Q17: How to judge the groove to be a single groove or a wide groove. ....	204
Q18: How is the grooving tool width determined? .....	205
Q19: Is it possible to use the same tool for both the rough grooving process and the finish grooving process? .....	209
Q20: How is the thread cutting process created in automatic process determination? .....	210
Q21: How is the ID thread shape defined? .....	214
Q22: How is the tap shape in turning defined? .....	215
Q23: How are automatic chamfers generated? How is the surface roughness of automatic chamfers defined? .....	217
Q24: How to create a new machining process in the process edit mode by making use of the existing machining process .....	219
Q25: Is it possible to change the cutting direction with ease? .....	220