

## Contents

|    |  |     |
|----|--|-----|
| 1  | Fundamentals / Overviews.....  | 45  |
| 2  | Using Fixed Cycles.....  | 49  |
| 3  | Fixed Cycles: Drilling.....  | 69  |
| 4  | Fixed Cycles: Tapping / Thread Milling.....                              | 99  |
| 5  | Fixed Cycles: Pocket Milling / Stud Milling / Slot Milling.....          | 135 |
| 6  | Fixed Cycles: Pattern Definitions.....                                   | 165 |
| 7  | Fixed Cycles: Contour Pocket.....  | 175 |
| 8  | Fixed Cycles: Cylindrical Surface.....                                   | 201 |
| 9  | Fixed Cycles: Contour Pocket with Contour Formula.....                   | 215 |
| 10 | Fixed Cycles: Multipass Milling.....                                     | 229 |
| 11 | Cycles: Coordinate Transformations.....                                  | 243 |
| 12 | Cycles: Special Functions.....   | 267 |
| 13 | Cycles: Turning.....   | 279 |
| 14 | Using Touch Probe Cycles.....  | 385 |
| 15 | Touch Probe Cycles: Automatic Measurement of Workpiece Misalignment..... | 395 |
| 16 | Touch Probe Cycles: Automatic Datum Setting.....                         | 415 |
| 17 | Touch Probe Cycles: Automatic Workpiece Inspection.....                  | 467 |
| 18 | Touch Probe Cycles: Special Functions.....                               | 511 |
| 19 | Touch Probe Cycles: Automatic Kinematics Measurement.....                | 525 |
| 20 | Touch Probe Cycles: Automatic Tool Measurement.....                      | 557 |
| 21 | Tables of Cycles.....  | 573 |



|          |                                      |           |
|----------|--------------------------------------|-----------|
| <b>1</b> | <b>Fundamentals / Overviews.....</b> | <b>45</b> |
| 1.1      | Introduction.....                    | 46        |
| 1.2      | Available Cycle Groups.....          | 47        |
|          | Overview of fixed cycles.....        | 47        |
|          | Overview of touch probe cycles.....  | 48        |

|            |  |           |
|------------|--|-----------|
| <b>2</b>   | <b>Using Fixed Cycles.....</b>                                 | <b>49</b> |
| <b>2.1</b> | <b>Working with fixed cycles.....</b>                          | <b>50</b> |
|            | Machine-specific cycles.....                                   | 50        |
|            | Defining a cycle using soft keys.....                          | 51        |
|            | Defining a cycle using the GOTO function.....                  | 51        |
|            | Calling a cycle.....   | 52        |
| <b>2.2</b> | <b>Program defaults for cycles.....</b>                        | <b>54</b> |
|            | Overview.....  | 54        |
|            | Entering GLOBAL DEF.....                                       | 54        |
|            | Using GLOBAL DEF information.....                              | 55        |
|            | Global data valid everywhere.....                              | 56        |
|            | Global data for drilling operations.....                       | 56        |
|            | Global data for milling operations with pocket cycles 25x..... | 56        |
|            | Global data for milling operations with contour cycles.....    | 57        |
|            | Global data for positioning behavior.....                      | 57        |
|            | Global data for probing functions.....                         | 57        |
| <b>2.3</b> | <b>PATTERN DEF pattern definition.....</b>                     | <b>58</b> |
|            | Application.....   | 58        |
|            | Entering PATTERN DEF.....                                      | 59        |
|            | Using PATTERN DEF.....   | 59        |
|            | Defining individual machining positions.....                   | 60        |
|            | Defining a single row.....                                     | 60        |
|            | Defining a single pattern.....                                 | 61        |
|            | Defining individual frames.....                                | 62        |
|            | Defining a full circle.....                                    | 63        |
|            | Defining a pitch circle.....                                   | 64        |
| <b>2.4</b> | <b>Point tables.....</b>                                       | <b>65</b> |
|            | Application.....   | 65        |
|            | Creating a point table.....                                    | 65        |
|            | Hiding single points from the machining process.....           | 66        |
|            | Selecting a point table in the program.....                    | 66        |
|            | Calling a cycle in connection with point tables.....           | 67        |

|            |  |           |
|------------|--|-----------|
| <b>3</b>   | <b>Fixed Cycles: Drilling</b>                        | <b>69</b> |
| <b>3.1</b> | <b>Fundamentals</b>                                  | <b>70</b> |
|            | Overview   | 70        |
| <b>3.2</b> | <b>CENTERING (Cycle 240, DIN/ISO: G240)</b>          | <b>71</b> |
|            | Cycle run  | 71        |
|            | Please note while programming:                       | 71        |
|            | Cycle parameters                                     | 72        |
| <b>3.3</b> | <b>DRILLING (Cycle 200)</b>                          | <b>73</b> |
|            | Cycle run  | 73        |
|            | Please note while programming:                       | 73        |
|            | Cycle parameters                                     | 74        |
| <b>3.4</b> | <b>REAMING (Cycle 201, DIN/ISO: G201)</b>            | <b>75</b> |
|            | Cycle run  | 75        |
|            | Please note while programming:                       | 75        |
|            | Cycle parameters                                     | 76        |
| <b>3.5</b> | <b>BORING (Cycle 202, DIN/ISO: G202)</b>             | <b>77</b> |
|            | Cycle run  | 77        |
|            | Please note while programming:                       | 78        |
|            | Cycle parameters                                     | 79        |
| <b>3.6</b> | <b>UNIVERSAL DRILLING (Cycle 203, DIN/ISO: G203)</b> | <b>80</b> |
|            | Cycle run  | 80        |
|            | Please note while programming:                       | 80        |
|            | Cycle parameters                                     | 81        |
| <b>3.7</b> | <b>BACK BORING (Cycle 204, DIN/ISO: G204)</b>        | <b>83</b> |
|            | Cycle run  | 83        |
|            | Please note while programming:                       | 84        |
|            | Cycle parameters                                     | 85        |
| <b>3.8</b> | <b>UNIVERSAL PECKING (Cycle 205, DIN/ISO: G205)</b>  | <b>86</b> |
|            | Cycle run  | 86        |
|            | Please note while programming:                       | 87        |
|            | Cycle parameters                                     | 88        |

|  |           |
|--|-----------|
| <b>3.9 BORE MILLING (Cycle 208)</b> .....                          | <b>90</b> |
| Cycle run.....   | 90        |
| Please note while programming:.....                                | 91        |
| Cycle parameters.....  | 92        |
| <b>3.10 SINGLE-LIP D.H.DRLNG (Cycle 241, DIN/ISO: G241)</b> .....  | <b>93</b> |
| Cycle run.....   | 93        |
| Please note while programming:.....                                | 93        |
| Cycle parameters.....  | 94        |
| <b>3.11 Programming Examples</b> .....                             | <b>96</b> |
| Example: Drilling cycles.....                                      | 96        |
| Example: Using drilling cycles in connection with PATTERN DEF..... | 97        |

|            |   |            |
|------------|---|------------|
| <b>4</b>   | <b>Fixed Cycles: Tapping / Thread Milling</b>                                     | <b>99</b>  |
| <b>4.1</b> | <b>Fundamentals</b>   | <b>100</b> |
|            | Overview  | 100        |
| <b>4.2</b> | <b>TAPPING NEW with a floating tap holder (Cycle 206, DIN/ISO: G206)</b>          | <b>101</b> |
|            | Cycle run   | 101        |
|            | Please note while programming:  | 102        |
|            | Cycle parameters  | 103        |
| <b>4.3</b> | <b>RIGID TAPPING without a floating tap holder NEW (Cycle 207, DIN/ISO: G207)</b> | <b>104</b> |
|            | Cycle run   | 104        |
|            | Please note while programming:  | 105        |
|            | Cycle parameters  | 106        |
| <b>4.4</b> | <b>TAPPING WITH CHIP BREAKING (Cycle 209, DIN/ISO: G209)</b>                      | <b>107</b> |
|            | Cycle run   | 107        |
|            | Please note while programming:  | 108        |
|            | Cycle parameters  | 109        |
| <b>4.5</b> | <b>Fundamentals of Thread Milling</b>   | <b>111</b> |
|            | Prerequisites   | 111        |
| <b>4.6</b> | <b>THREAD MILLING (Cycle 262, DIN/ISO: G262)</b>                                  | <b>113</b> |
|            | Cycle run   | 113        |
|            | Please note while programming:  | 114        |
|            | Cycle parameters  | 115        |
| <b>4.7</b> | <b>THREAD MILLING/COUNTERSINKING (Cycle 263, DIN/ISO:G263)</b>                    | <b>116</b> |
|            | Cycle run   | 116        |
|            | Please note while programming:  | 117        |
|            | Cycle parameters  | 118        |
| <b>4.8</b> | <b>THREAD DRILLING/MILLING (Cycle 264, DIN/ISO: G264)</b>                         | <b>120</b> |
|            | Cycle run   | 120        |
|            | Please note while programming:  | 121        |
|            | Cycle parameters  | 122        |



|   |            |
|---|------------|
| <b>4.9 HELICAL THREAD DRILLING/MILLING (Cycle 265, DIN/ISO: G265)</b> ..... | <b>124</b> |
| Cycle run.....  | 124        |
| Please note while programming:.....   | 125        |
| Cycle parameters.....   | 126        |
| <b>4.10 OUTSIDE THREAD MILLING (Cycle 267, DIN/ISO: G267)</b> .....         | <b>128</b> |
| Cycle run.....  | 128        |
| Please note while programming:.....   | 129        |
| Cycle parameters.....   | 130        |
| <b>4.11 Programming Examples</b> .....                                      | <b>132</b> |
| Example: Thread milling.....  | 132        |

|          |   |            |
|----------|---|------------|
| <b>5</b> | <b>Fixed Cycles: Pocket Milling / Stud Milling / Slot Milling</b> | <b>135</b> |
| 5.1      | <b>Fundamentals</b>   | <b>136</b> |
|          | Overview  | 136        |
| 5.2      | <b>RECTANGULAR POCKET (Cycle 251, DIN/ISO: G251)</b>              | <b>137</b> |
|          | Cycle run   | 137        |
|          | Please note while programming:                                    | 138        |
|          | Cycle parameters  | 139        |
| 5.3      | <b>CIRCULAR POCKET (Cycle 252, DIN/ISO: G252)</b>                 | <b>141</b> |
|          | Cycle run   | 141        |
|          | Please note while programming:                                    | 142        |
|          | Cycle parameters  | 143        |
| 5.4      | <b>SLOT MILLING (Cycle 253, DIN/ISO: G253)</b>                    | <b>145</b> |
|          | Cycle run   | 145        |
|          | Please note while programming:                                    | 146        |
|          | Cycle parameters  | 147        |
| 5.5      | <b>CIRCULAR SLOT (Cycle 254, DIN/ISO: G254)</b>                   | <b>149</b> |
|          | Cycle run   | 149        |
|          | Please note while programming:                                    | 150        |
|          | Cycle parameters  | 151        |
| 5.6      | <b>RECTANGULAR STUD (Cycle 256, DIN/ISO: G256)</b>                | <b>154</b> |
|          | Cycle run   | 154        |
|          | Please note while programming:                                    | 155        |
|          | Cycle parameters  | 156        |
| 5.7      | <b>CIRCULAR STUD (Cycle 257, DIN/ISO: G257)</b>                   | <b>158</b> |
|          | Cycle run   | 158        |
|          | Please note while programming:                                    | 158        |
|          | Cycle parameters  | 160        |
| 5.8      | <b>Programming Examples</b>                                       | <b>162</b> |
|          | Example: Milling pockets, studs and slots                         | 162        |

|            |   |            |
|------------|---|------------|
| <b>6</b>   | <b>Fixed Cycles: Pattern Definitions.....</b>           | <b>165</b> |
| <b>6.1</b> | <b>Fundamentals.....</b>                                | <b>166</b> |
|            | Overview.....   | 166        |
| <b>6.2</b> | <b>CIRCULAR PATTERN (Cycle 220, DIN/ISO: G220).....</b> | <b>167</b> |
|            | Cycle run.....  | 167        |
|            | Please note while programming:.....                     | 167        |
|            | Cycle parameters.....                                   | 168        |
| <b>6.3</b> | <b>LINEAR PATTERN (Cycle 221, DIN/ISO: G221).....</b>   | <b>170</b> |
|            | Cycle run.....  | 170        |
|            | Please note while programming:.....                     | 170        |
|            | Cycle parameters.....                                   | 171        |
| <b>6.4</b> | <b>Programming Examples.....</b>                        | <b>172</b> |
|            | Example: Polar hole patterns.....                       | 172        |

|            |  |            |
|------------|--|------------|
| <b>7</b>   | <b>Fixed Cycles: Contour Pocket</b>              | <b>175</b> |
| <b>7.1</b> | <b>SL Cycles</b>                                 | <b>176</b> |
|            | Fundamentals                                     | 176        |
|            | Overview   | 177        |
| <b>7.2</b> | <b>CONTOUR (Cycle 14, DIN/ISO: G37)</b>          | <b>178</b> |
|            | Please note while programming:                   | 178        |
|            | Cycle parameters                                 | 178        |
| <b>7.3</b> | <b>Superimposed contours</b>                     | <b>179</b> |
|            | Fundamentals                                     | 179        |
|            | Subprograms: overlapping pockets                 | 179        |
|            | Area of inclusion                                | 180        |
|            | Area of exclusion                                | 181        |
|            | Area of intersection                             | 182        |
| <b>7.4</b> | <b>CONTOUR DATA (Cycle 20, DIN/ISO: G120)</b>    | <b>183</b> |
|            | Please note while programming:                   | 183        |
|            | Cycle parameters                                 | 184        |
| <b>7.5</b> | <b>PILOT DRILLING (Cycle 21, DIN/ISO: G121)</b>  | <b>185</b> |
|            | Cycle run  | 185        |
|            | Please note while programming:                   | 185        |
|            | Cycle parameters                                 | 186        |
| <b>7.6</b> | <b>ROUGHING (Cycle 22, DIN/ISO: G122)</b>        | <b>187</b> |
|            | Cycle run  | 187        |
|            | Please note while programming:                   | 188        |
|            | Cycle parameters                                 | 189        |
| <b>7.7</b> | <b>FLOOR FINISHING (Cycle 23, DIN/ISO: G123)</b> | <b>190</b> |
|            | Cycle run  | 190        |
|            | Please note while programming:                   | 190        |
|            | Cycle parameters                                 | 190        |
| <b>7.8</b> | <b>SIDE FINISHING (Cycle 24, DIN/ISO: G124)</b>  | <b>191</b> |
|            | Cycle run  | 191        |
|            | Please note while programming:                   | 191        |
|            | Cycle parameters                                 | 192        |



|             |   |            |
|-------------|---|------------|
| <b>7.9</b>  | <b>CONTOUR TRAIN (Cycle 25, DIN/ISO: G125)</b> .....                          | <b>193</b> |
|             | Cycle run.....  | 193        |
|             | Please note while programming:.....   | 193        |
|             | Cycle parameters.....   | 194        |
| <b>7.10</b> | <b>Programming Examples</b> .....   | <b>195</b> |
|             | Example: Roughing-out and fine-roughing a pocket.....                         | 195        |
|             | Example: Pilot drilling, roughing-out and finishing overlapping contours..... | 197        |
|             | Example: Contour train.....   | 199        |



|            |  |            |
|------------|--|------------|
| <b>8</b>   | <b>Fixed Cycles: Cylindrical Surface</b>   | <b>201</b> |
| <b>8.1</b> | <b>Fundamentals</b>  | <b>202</b> |
|            | Overview of cylindrical surface cycles   | 202        |
| <b>8.2</b> | <b>CYLINDER SURFACE (Cycle 27, DIN/ISO: G127, software option 1)</b>               | <b>203</b> |
|            | Cycle call   | 203        |
|            | Please note while programming:   | 204        |
|            | Cycle parameters   | 205        |
| <b>8.3</b> | <b>CYLINDER SURFACE Slot milling (Cycle 28, DIN/ISO: G128, software option 1)</b>  | <b>206</b> |
|            | Cycle run  | 206        |
|            | Please note while programming:   | 207        |
|            | Cycle parameters   | 208        |
| <b>8.4</b> | <b>CYLINDER SURFACE Ridge milling (Cycle 29, DIN/ISO: G129, software option 1)</b> | <b>209</b> |
|            | Cycle run  | 209        |
|            | Please note while programming:   | 210        |
|            | Cycle parameters   | 211        |
| <b>8.5</b> | <b>Programming Examples</b>  | <b>212</b> |
|            | Example: Cylinder surface with Cycle 27  | 212        |
|            | Example: Cylinder surface with Cycle 28  | 214        |

|            |   |            |
|------------|---|------------|
| <b>9</b>   | <b>Fixed Cycles: Contour Pocket with Contour Formula.....</b>                       | <b>215</b> |
| <b>9.1</b> | <b>SL cycles with complex contour formula.....</b>                                  | <b>216</b> |
|            | Fundamentals.....   | 216        |
|            | Selecting a program with contour definitions.....                                   | 218        |
|            | Defining contour descriptions.....  | 218        |
|            | Entering a complex contour formula.....   | 219        |
|            | Superimposed contours.....  | 220        |
|            | Contour machining with SL Cycles.....   | 222        |
|            | Example: Roughing and finishing superimposed contours with the contour formula..... | 223        |
| <b>9.2</b> | <b>SL cycles with simple contour formula.....</b>                                   | <b>226</b> |
|            | Fundamentals.....   | 226        |
|            | Entering a simple contour formula.....  | 228        |
|            | Contour machining with SL Cycles.....   | 228        |



|  |            |
|--|------------|
| <b>10 Fixed Cycles: Multipass Milling</b> .....                | <b>229</b> |
| <b>10.1 Fundamentals</b> .....                                 | <b>230</b> |
| Overview.....  | 230        |
| <b>10.2 MULTIPASS MILLING (Cycle 230, DIN/ISO: G230)</b> ..... | <b>231</b> |
| Cycle run.....   | 231        |
| Please note while programming:.....                            | 231        |
| Cycle parameters.....  | 232        |
| <b>10.3 RULED SURFACE (Cycle 231, DIN/ISO: G231)</b> .....     | <b>233</b> |
| Cycle run.....   | 233        |
| Please note while programming:.....                            | 234        |
| Cycle parameters.....  | 235        |
| <b>10.4 FACE MILLING (Cycle 232, DIN/ISO: G232)</b> .....      | <b>237</b> |
| Cycle run.....   | 237        |
| Please note while programming:.....                            | 239        |
| Cycle parameters.....  | 239        |
| <b>10.5 Programming Examples</b> .....                         | <b>241</b> |
| Example: Multipass milling.....                                | 241        |

|   |            |
|---|------------|
| <b>11 Cycles: Coordinate Transformations.....</b>                             | <b>243</b> |
| <b>11.1 Fundamentals.....</b>   | <b>244</b> |
| Overview.....   | 244        |
| Effect of coordinate transformations.....                                     | 244        |
| <b>11.2 DATUM SHIFT (Cycle 7, DIN/ISO: G54).....</b>                          | <b>245</b> |
| Effect.....   | 245        |
| Cycle parameters.....   | 245        |
| <b>11.3 DATUM SHIFT with datum tables (Cycle 7, DIN/ISO: G53).....</b>        | <b>246</b> |
| Effect.....   | 246        |
| Please note while programming:.....   | 247        |
| Cycle parameters.....   | 247        |
| Selecting a datum table in the part program.....                              | 248        |
| Editing the datum table in the Programming and Editing mode of operation..... | 248        |
| Configuring the datum table.....  | 250        |
| To exit a datum table.....  | 250        |
| Status displays.....  | 250        |
| <b>11.4 DATUM SETTING (Cycle 247, DIN/ISO: G247).....</b>                     | <b>251</b> |
| Effect.....   | 251        |
| Please note before programming:.....  | 251        |
| Cycle parameters.....   | 251        |
| Status displays.....  | 251        |
| <b>11.5 MIRRORING (Cycle 8, DIN/ISO: G28).....</b>                            | <b>252</b> |
| Effect.....   | 252        |
| Please note while programming:.....   | 253        |
| Cycle parameters.....   | 253        |
| <b>11.6 ROTATION (Cycle 10, DIN/ISO: G73).....</b>                            | <b>254</b> |
| Effect.....   | 254        |
| Please note while programming:.....   | 255        |
| Cycle parameters.....   | 255        |
| <b>11.7 SCALING (Cycle 11, DIN/ISO: G72).....</b>                             | <b>256</b> |
| Effect.....   | 256        |
| Cycle parameters.....   | 256        |



**11.8 AXIS-SPECIFIC SCALING (Cycle 26)..... 257**

Effect..... 257  
Please note while programming:..... 257  
Cycle parameters..... 258

**11.9 WORKING PLANE (Cycle 19, DIN/ISO: G80, software option 1)..... 259**

Effect..... 259  
Please note while programming:..... 260  
Cycle parameters..... 260  
Resetting..... 261  
Positioning the axes of rotation..... 261  
Position display in the tilted system..... 262  
Workspace monitoring..... 262  
Positioning in a tilted coordinate system..... 263  
Combining coordinate transformation cycles..... 263  
Procedure for working with Cycle 19 WORKING PLANE..... 264

**11.10 Programming Examples..... 265**

Example: Coordinate transformation cycles..... 265

|   |            |
|---|------------|
| <b>12 Cycles: Special Functions.....</b>                      | <b>267</b> |
| <b>12.1 Fundamentals.....</b>                                 | <b>268</b> |
| Overview.....   | 268        |
| <b>12.2 DWELL TIME (Cycle 9, DIN/ISO: G04).....</b>           | <b>269</b> |
| Function.....   | 269        |
| Cycle parameters.....   | 269        |
| <b>12.3 PROGRAM CALL (Cycle 12, DIN/ISO: G39).....</b>        | <b>270</b> |
| Cycle function.....   | 270        |
| Please note while programming:.....                           | 270        |
| Cycle parameters.....   | 271        |
| <b>12.4 SPINDLE ORIENTATION (Cycle 13, DIN/ISO: G36).....</b> | <b>272</b> |
| Cycle function.....   | 272        |
| Please note while programming:.....                           | 272        |
| Cycle parameters.....   | 272        |
| <b>12.5 TOLERANCE (Cycle 32, DIN/ISO: G62).....</b>           | <b>273</b> |
| Cycle function.....   | 273        |
| Influences of the geometry definition in the CAM system.....  | 273        |
| Please note while programming:.....                           | 274        |
| Cycle parameters.....   | 275        |
| <b>12.6 ENGRAVING (Cycle 225, DIN/ISO: G225).....</b>         | <b>276</b> |
| Cycle run.....  | 276        |
| Please note while programming:.....                           | 276        |
| Cycle parameters.....   | 277        |
| Allowed engraving characters.....                             | 278        |
| Characters that cannot be printed.....                        | 278        |
| Engraving system variables.....                               | 278        |

|  |            |
|--|------------|
| <b>13 Cycles: Turning</b> .....  | <b>279</b> |
| <b>13.1 Turning Cycles (software option 50)</b> .....                            | <b>280</b> |
| Overview.....  | 280        |
| Working with turning cycles.....   | 283        |
| Blank form update (FUNCTION TURNDATA).....                                       | 284        |
| <b>13.2 ADAPT ROTARY COORDINATE SYSTEM(Cycle 800, DIN/ISO: G800)</b> .....       | <b>286</b> |
| Application.....   | 286        |
| Effect.....  | 287        |
| Cycle parameters.....  | 287        |
| <b>13.3 RESET ROTARY COORDINATE SYSTEM (Cycle 801, DIN/ISO: G801)</b> .....      | <b>288</b> |
| Application.....   | 288        |
| Effect.....  | 288        |
| Cycle parameters.....  | 288        |
| <b>13.4 Fundamentals of Turning Cycles</b> .....                                 | <b>289</b> |
| <b>13.5 TURN SHOULDER LONGITUDINAL (Cycle 811, DIN/ISO: G811)</b> .....          | <b>290</b> |
| Application.....   | 290        |
| Roughing cycle run.....  | 290        |
| Finishing cycle run.....   | 290        |
| Please note while programming:.....  | 291        |
| Cycle parameters.....  | 291        |
| <b>13.6 TURN SHOULDER LONGITUDINAL EXTENDED (Cycle 812, DIN/ISO: G812)</b> ..... | <b>292</b> |
| Application.....   | 292        |
| Roughing cycle run.....  | 292        |
| Finishing cycle run.....   | 293        |
| Please note while programming:.....  | 293        |
| Cycle parameters.....  | 294        |
| <b>13.7 TURN, LONGITUDINAL PLUNGE (Cycle 813, DIN/ISO: G813)</b> .....           | <b>296</b> |
| Application.....   | 296        |
| Roughing cycle run.....  | 296        |
| Finishing cycle run.....   | 297        |
| Please note while programming:.....  | 297        |
| Cycle parameters.....  | 298        |

|   |            |
|---|------------|
| <b>13.8 TURN, LONGITUDINAL PLUNGE EXTENDED (Cycle 814, DIN/ISO: G814)</b> ..... | <b>299</b> |
| Application.....  | 299        |
| Roughing cycle run.....   | 299        |
| Finishing cycle run.....  | 300        |
| Please note while programming:.....   | 300        |
| Cycle parameters.....   | 301        |
| <b>13.9 TURN CONTOUR LONGITUDINAL (Cycle 810, DIN/ISO: G810)</b> .....          | <b>303</b> |
| Application.....  | 303        |
| Roughing cycle run.....   | 303        |
| Finishing cycle run.....  | 304        |
| Please note while programming:.....   | 304        |
| Cycle parameters.....   | 305        |
| <b>13.10 TURN CONTOUR-PARALLEL (Cycle 815, DIN/ISO: G815)</b> .....             | <b>307</b> |
| Application.....  | 307        |
| Roughing cycle run.....   | 307        |
| Finishing cycle run.....  | 308        |
| Please note while programming:.....   | 308        |
| Cycle parameters.....   | 309        |
| <b>13.11 TURN SHOULDER FACE (Cycle 821, DIN/ISO: G821)</b> .....                | <b>311</b> |
| Application.....  | 311        |
| Roughing cycle run.....   | 311        |
| Finishing cycle run.....  | 312        |
| Please note while programming:.....   | 312        |
| Cycle parameters.....   | 313        |
| <b>13.12 TURN SHOULDER FACE EXTENDED (Cycle 822, DIN/ISO: G822)</b> .....       | <b>314</b> |
| Application.....  | 314        |
| Roughing cycle run.....   | 314        |
| Finishing cycle run.....  | 315        |
| Please note while programming:.....   | 315        |
| Cycle parameters.....   | 316        |

**13.13 TURN, TRANSVERSE PLUNGE (Cycle 823, DIN/ISO: G823)..... 318**

Application..... 318  
Roughing cycle run..... 318  
Finishing cycle run..... 319  
Please note while programming:..... 319  
Cycle parameters..... 320

**13.14 TURN, TRANSVERSE PLUNGE EXTENDED (Cycle 824, DIN/ISO: G824)..... 321**

Application..... 321  
Roughing cycle run..... 321  
Finishing cycle run..... 322  
Please note while programming:..... 322  
Cycle parameters..... 323

**13.15 TURN CONTOUR FACE (Cycle 820, DIN/ISO: G820)..... 325**

Application..... 325  
Roughing cycle run..... 325  
Finishing cycle run..... 326  
Please note while programming:..... 326  
Cycle parameters..... 327

**13.16 SIMPLE RADIAL RECESSING (Cycle 841, DIN/ISO: G841)..... 329**

Application..... 329  
Roughing cycle run..... 329  
Finishing cycle run..... 330  
Please note while programming:..... 330  
Cycle parameters..... 331

**13.17 RADIAL RECESSING EXTENDED(Cycle 842, DIN/ISO: G842)..... 332**

Application..... 332  
Roughing cycle run..... 332  
Finishing cycle run..... 333  
Please note while programming:..... 333  
Cycle parameters..... 334

|   |            |
|---|------------|
| <b>13.18 RECESSING CONTOUR RADIAL(Cycle 840, DIN/ISO: G840)</b> ..... | <b>337</b> |
| Application.....  | 337        |
| Roughing cycle run.....   | 337        |
| Finishing cycle run.....  | 338        |
| Please note while programming:.....                                   | 338        |
| Cycle parameters.....   | 339        |
| <b>13.19 SIMPLE AXIAL RECESSING (Cycle 851, DIN/ISO: G851)</b> .....  | <b>341</b> |
| Application.....  | 341        |
| Roughing cycle run.....   | 341        |
| Finishing cycle run.....  | 342        |
| Please note while programming:.....                                   | 342        |
| Cycle parameters.....   | 343        |
| <b>13.20 AXIAL RECESSING EXTENDED(Cycle 852, DIN/ISO: G852)</b> ..... | <b>344</b> |
| Application.....  | 344        |
| Roughing cycle run.....   | 344        |
| Finishing cycle run.....  | 345        |
| Please note while programming:.....                                   | 345        |
| Cycle parameters.....   | 346        |
| <b>13.21 AXIAL RECESSING(Cycle 850, DIN/ISO: G850)</b> .....          | <b>349</b> |
| Application.....  | 349        |
| Roughing cycle run.....   | 349        |
| Finishing cycle run.....  | 350        |
| Please note while programming:.....                                   | 350        |
| Cycle parameters.....   | 351        |
| <b>13.22 RADIAL RECESSING (Cycle 861, DIN/ISO: G861)</b> .....        | <b>353</b> |
| Application.....  | 353        |
| Roughing cycle run.....   | 353        |
| Finishing cycle run.....  | 354        |
| Please note while programming:.....                                   | 354        |
| Cycle parameters.....   | 355        |



**13.23 RADIAL RECESSING EXTENDED(Cycle 862, DIN/ISO: G862)..... 356**

|                                     |     |
|-------------------------------------|-----|
| Application.....                    | 356 |
| Roughing cycle run.....             | 356 |
| Finishing cycle run.....            | 357 |
| Please note while programming:..... | 357 |
| Cycle parameters.....               | 358 |

**13.24 RECESSING CONTOUR RADIAL(Cycle 860, DIN/ISO: G860)..... 360**

|                                     |     |
|-------------------------------------|-----|
| Application.....                    | 360 |
| Roughing cycle run.....             | 360 |
| Finishing cycle run.....            | 361 |
| Please note while programming:..... | 361 |
| Cycle parameters.....               | 362 |

**13.25 AXIAL RECESSING (Cycle 871, DIN/ISO: G871)..... 363**

|                                     |     |
|-------------------------------------|-----|
| Application.....                    | 363 |
| Roughing cycle run.....             | 363 |
| Finishing cycle run.....            | 363 |
| Please note while programming:..... | 364 |
| Cycle parameters.....               | 364 |

**13.26 AXIAL RECESSING EXTENDED(Cycle 872, DIN/ISO: G872)..... 365**

|                                     |     |
|-------------------------------------|-----|
| Application.....                    | 365 |
| Roughing cycle run.....             | 365 |
| Finishing cycle run.....            | 366 |
| Please note while programming:..... | 366 |
| Cycle parameters.....               | 367 |

**13.27 AXIAL RECESSING(Cycle 870, DIN/ISO: G870)..... 369**

|                                     |     |
|-------------------------------------|-----|
| Application.....                    | 369 |
| Roughing cycle run.....             | 369 |
| Finishing cycle run.....            | 370 |
| Please note while programming:..... | 370 |
| Cycle parameters.....               | 371 |

|   |            |
|---|------------|
| <b>13.28 THREAD LONGITUDINAL (Cycle 831, DIN/ISO: G831)</b> .....     | <b>372</b> |
| Application.....  | 372        |
| Cycle run.....  | 372        |
| Please note while programming:.....                                   | 373        |
| Cycle parameters.....   | 374        |
| <b>13.29 THREAD EXTENDED (Cycle 832, DIN/ISO: G832)</b> .....         | <b>375</b> |
| Application.....  | 375        |
| Cycle run.....  | 375        |
| Please note while programming:.....                                   | 376        |
| Cycle parameters.....   | 377        |
| <b>13.30 CONTOUR-PARALLEL THREAD (Cycle 830, DIN/ISO: G830)</b> ..... | <b>379</b> |
| Application.....  | 379        |
| Cycle run.....  | 379        |
| Please note while programming:.....                                   | 380        |
| Cycle parameters.....   | 381        |
| <b>13.31 Example program</b> .....                                    | <b>383</b> |
| Example: Shoulder with recess.....                                    | 383        |



**14 Using Touch Probe Cycles..... 385**

**14.1 General information about touch probe cycles..... 386**

Method of function..... 386

Consideration of a basic rotation in the Manual Operation mode..... 386

Cycles in the Manual and El. Handwheel modes..... 386

Touch probe cycles for automatic operation..... 387

**14.2 Before You Start Working with Touch Probe Cycles..... 389**

Maximum traverse to touch point: DIST in touch probe table..... 389

Set-up clearance to touch point: SET\_UP in touch probe table..... 389

Orient the infrared touch probe to the programmed probe direction: TRACK in touch probe table..... 389

Touch trigger probe, probing feed rate: F in touch probe table..... 390

Touch trigger probe, rapid traverse for positioning: FMAX..... 390

Touch trigger probe, rapid traverse for positioning: F\_PREPOS in touch probe table..... 390

Multiple measurements..... 391

Confidence interval of multiple measurements..... 391

Executing touch probe cycles..... 392

**14.3 Touch probe table..... 393**

General information..... 393

Editing touch probe tables..... 393


Touch probe data..... 394

|  |            |
|--|------------|
| <b>15 Touch Probe Cycles: Automatic Measurement of Workpiece Misalignment.....</b>                     | <b>395</b> |
| <b>15.1 Fundamentals.....</b>  | <b>396</b> |
| Overview.....  | 396        |
| Characteristics common to all touch probe cycles for measuring workpiece misalignment.....             | 397        |
| <b>15.2 BASIC ROTATION (Cycle 400, DIN/ISO: G400).....</b>   | <b>398</b> |
| Cycle run.....   | 398        |
| Please note while programming:.....  | 398        |
| Cycle parameters.....  | 399        |
| <b>15.3 BASIC ROTATION over two holes (Cycle 401, DIN/ISO: G401).....</b>                              | <b>401</b> |
| Cycle run.....   | 401        |
| Please note while programming:.....  | 401        |
| Cycle parameters.....  | 402        |
| <b>15.4 BASIC ROTATION over two studs (Cycle 402, DIN/ISO: G402).....</b>                              | <b>404</b> |
| Cycle run.....   | 404        |
| Please note while programming:.....  | 404        |
| Cycle parameters.....  | 405        |
| <b>15.5 BASIC ROTATION compensation via rotary axis (Cycle 403, DIN/ISO: G403).....</b>                | <b>407</b> |
| Cycle run.....   | 407        |
| Please note while programming:.....  | 407        |
| Cycle parameters.....  | 408        |
| <b>15.6 SET BASIC ROTATION (Cycle 404, DIN/ISO: G404).....</b>   | <b>410</b> |
| Cycle run.....   | 410        |
| Cycle parameters.....  | 410        |
| <b>15.7 Compensating workpiece misalignment by rotating the C axis (Cycle 405, DIN/ISO: G405).....</b> | <b>411</b> |
| Cycle run.....   | 411        |
| Please note while programming:.....  | 412        |
| Cycle parameters.....  | 412        |
| <b>15.8 Example: Determining a basic rotation from two holes.....</b>                                  | <b>414</b> |



|   |            |
|---|------------|
| <b>16 Touch Probe Cycles: Automatic Datum Setting.....</b>                  | <b>415</b> |
| <b>16.1 Fundamentals.....</b>   | <b>416</b> |
| Overview.....   | 416        |
| Characteristics common to all touch probe cycles for datum setting.....     | 418        |
| <b>16.2 DATUM SLOT CENTER (Cycle 408, DIN/ISO: G408).....</b>               | <b>420</b> |
| Cycle run.....  | 420        |
| Please note while programming:.....   | 421        |
| Cycle parameters.....   | 422        |
| <b>16.3 DATUM RIDGE CENTER (Cycle 409, DIN/ISO: G409).....</b>              | <b>424</b> |
| Cycle run.....  | 424        |
| Please note while programming:.....   | 424        |
| Cycle parameters.....   | 425        |
| <b>16.4 DATUM FROM INSIDE OF RECTANGLE (Cycle 410, DIN/ISO: G410).....</b>  | <b>427</b> |
| Cycle run.....  | 427        |
| Please note while programming:.....   | 428        |
| Cycle parameters.....   | 429        |
| <b>16.5 DATUM FROM OUTSIDE OF RECTANGLE (Cycle 411, DIN/ISO: G411).....</b> | <b>431</b> |
| Cycle run.....  | 431        |
| Please note while programming:.....   | 432        |
| Cycle parameters.....   | 432        |
| <b>16.6 DATUM FROM INSIDE OF CIRCLE (Cycle 412, DIN/ISO: G412).....</b>     | <b>435</b> |
| Cycle run.....  | 435        |
| Please note while programming:.....   | 436        |
| Cycle parameters.....   | 437        |
| <b>16.7 DATUM FROM OUTSIDE OF CIRCLE (Cycle 413, DIN/ISO: G413).....</b>    | <b>440</b> |
| Cycle run.....  | 440        |
| Please note while programming:.....   | 440        |
| Cycle parameters.....   | 441        |
| <b>16.8 DATUM FROM OUTSIDE OF CORNER (Cycle 414, DIN/ISO: G414).....</b>    | <b>444</b> |
| Cycle run.....  | 444        |
| Please note while programming:.....   | 445        |
| Cycle parameters.....   | 446        |

|   |            |
|---|------------|
| <b>16.9 DATUM FROM INSIDE OF CORNER (Cycle 415, DIN/ISO: G415)</b> .....                                  | <b>448</b> |
| Cycle run.....  | 448        |
| Please note while programming:.....   | 448        |
| Cycle parameters.....   | 449        |
| <b>16.10 DATUM CIRCLE CENTER (Cycle 416, DIN/ISO: G416)</b> .....   | <b>451</b> |
| Cycle run.....  | 451        |
| Please note while programming:.....   | 452        |
| Cycle parameters.....   | 452        |
| <b>16.11 DATUM IN TOUCH PROBE AXIS (Cycle 417, DIN/ISO: G417)</b> .....                                   | <b>455</b> |
| Cycle run.....  | 455        |
| Please note while programming:.....   | 455        |
| Cycle parameters.....   | 456        |
| <b>16.12 DATUM AT CENTER OF 4 HOLES (Cycle 418, DIN/ISO: G418)</b> .....                                  | <b>457</b> |
| Cycle run.....  | 457        |
| Please note while programming:.....   | 458        |
| Cycle parameters.....   | 458        |
| <b>16.13 DATUM IN ONE AXIS (Cycle 419, DIN/ISO: G419)</b> .....   | <b>461</b> |
| Cycle run.....  | 461        |
| Please note while programming:.....   | 461        |
| Cycle parameters.....   | 462        |
| <b>16.14 Example: Datum setting in center of a circular segment and on top surface of workpiece</b> ..... | <b>464</b> |
| <b>16.15 Example: Datum setting on top surface of workpiece and in center of a bolt hole circle</b> ..... | <b>465</b> |

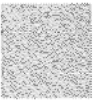


|  |            |
|--|------------|
| <b>17 Touch Probe Cycles: Automatic Workpiece Inspection.....</b>    | <b>467</b> |
| <b>17.1 Fundamentals.....</b>  | <b>468</b> |
| Overview.....  | 468        |
| Recording the results of measurement.....                            | 469        |
| Measurement results in Q parameters.....                             | 471        |
| Classification of results.....                                       | 471        |
| Tolerance monitoring.....  | 471        |
| Tool monitoring.....   | 472        |
| Reference system for measurement results.....                        | 473        |
| <b>17.2 DATUM PLANE (Cycle 0, DIN/ISO: G55).....</b>                 | <b>474</b> |
| Cycle run.....   | 474        |
| Please note while programming:.....                                  | 474        |
| Cycle parameters.....  | 474        |
| <b>17.3 POLAR DATUM PLANE (Cycle 1).....</b>                         | <b>475</b> |
| Cycle run.....   | 475        |
| Please note while programming:.....                                  | 475        |
| Cycle parameters.....  | 475        |
| <b>17.4 MEASURE ANGLE (Cycle 420, DIN/ISO: G420).....</b>            | <b>476</b> |
| Cycle run.....   | 476        |
| Please note while programming:.....                                  | 476        |
| Cycle parameters.....  | 477        |
| <b>17.5 MEASURE HOLE (Cycle 421, DIN/ISO: G421).....</b>             | <b>479</b> |
| Cycle run.....   | 479        |
| Please note while programming:.....                                  | 479        |
| Cycle parameters.....  | 480        |
| <b>17.6 MEASURE HOLE OUTSIDE (Cycle 422, DIN/ISO: G422).....</b>     | <b>482</b> |
| Cycle run.....   | 482        |
| Please note while programming:.....                                  | 482        |
| Cycle parameters.....  | 483        |
| <b>17.7 MEASURE RECTANGLE INSIDE (Cycle 423, DIN/ISO: G423).....</b> | <b>485</b> |
| Cycle run.....   | 485        |
| Please note while programming:.....                                  | 486        |
| Cycle parameters.....  | 486        |

|   |            |
|---|------------|
| <b>17.8 MEASURE RECTANGLE OUTSIDE (Cycle 424, DIN/ISO: G424)</b>  | <b>489</b> |
| Cycle run   | 489        |
| Please note while programming:                                    | 489        |
| Cycle parameters  | 490        |
| <b>17.9 MEASURE INSIDE WIDTH (Cycle 425, DIN/ISO: G425)</b>       | <b>492</b> |
| Cycle run   | 492        |
| Please note while programming:                                    | 492        |
| Cycle parameters  | 493        |
| <b>17.10 MEASURE RIDGE WIDTH (Cycle 426, DIN/ISO: G426)</b>       | <b>495</b> |
| Cycle run   | 495        |
| Please note while programming:                                    | 495        |
| Cycle parameters  | 496        |
| <b>17.11 MEASURE COORDINATE (Cycle 427, DIN/ISO: G427)</b>        | <b>498</b> |
| Cycle run   | 498        |
| Please note while programming:                                    | 498        |
| Cycle parameters  | 499        |
| <b>17.12 MEASURE BOLT HOLE CIRCLE (Cycle 430, DIN/ISO: G430)</b>  | <b>501</b> |
| Cycle run   | 501        |
| Please note while programming:                                    | 502        |
| Cycle parameters  | 502        |
| <b>17.13 MEASURE PLANE (Cycle 431, DIN/ISO: G431)</b>             | <b>504</b> |
| Cycle run   | 504        |
| Please note while programming:                                    | 505        |
| Cycle parameters  | 505        |
| <b>17.14 Programming Examples</b>                                 | <b>507</b> |
| Example: Measuring and reworking a rectangular stud               | 507        |
| Example: Measuring a rectangular pocket and recording the results | 509        |

|   |            |
|---|------------|
| <b>18 Touch Probe Cycles: Special Functions.....</b>                    | <b>511</b> |
| <b>18.1 Fundamentals.....</b>   | <b>512</b> |
| Overview.....   | 512        |
| <b>18.2 MEASURE (Cycle 3).....</b>                                      | <b>513</b> |
| Cycle run.....  | 513        |
| Please note while programming:.....                                     | 513        |
| Cycle parameters.....   | 514        |
| <b>18.3 Calibrating a touch trigger probe.....</b>                      | <b>515</b> |
| <b>18.4 Displaying calibration values.....</b>                          | <b>516</b> |
| <b>18.5 CALIBRATE TS (Cycle 460, DIN/ISO: G460).....</b>                | <b>517</b> |
| <b>18.6 CALIBRATE TS LENGTH (Cycle 461, DIN/ISO: G461).....</b>         | <b>519</b> |
| <b>18.7 CALIBRATE TS RADIUS INSIDE (Cycle 462, DIN/ISO: G462).....</b>  | <b>520</b> |
| <b>18.8 CALIBRATE TS RADIUS OUTSIDE (Cycle 463, DIN/ISO: G463).....</b> | <b>522</b> |

|   |            |
|---|------------|
| <b>19 Touch Probe Cycles: Automatic Kinematics Measurement.....</b>                 | <b>525</b> |
| <b>19.1 Kinematics Measurement with TS Touch Probes (KinematicsOpt option).....</b> | <b>526</b> |
| Fundamentals.....   | 526        |
| Overview.....   | 527        |
| <b>19.2 Prerequisites.....</b>  | <b>528</b> |
| Please note while programming:.....   | 528        |
| <b>19.3 SAVE KINEMATICS (Cycle 450, DIN/ISO: G450, Option).....</b>                 | <b>529</b> |
| Cycle run.....  | 529        |
| Please note while programming:.....   | 529        |
| Cycle parameters.....   | 530        |
| Logging function.....   | 530        |
| Notes on data management.....   | 531        |
| <b>19.4 MEASURE KINEMATICS (Cycle 451, DIN/ISO: G451, option).....</b>              | <b>532</b> |
| Cycle run.....  | 532        |
| Positioning direction.....  | 534        |
| Machines with Hirth-coupled axes.....   | 535        |
| Choice of number of measuring points.....   | 536        |
| Choice of the calibration sphere position on the machine table.....                 | 537        |
| Notes on the accuracy.....  | 537        |
| Notes on various calibration methods.....   | 538        |
| Backlash.....   | 539        |
| Please note while programming:.....   | 540        |
| Cycle parameters.....   | 541        |
| Various modes (Q406).....   | 544        |
| Logging function.....   | 545        |
| <b>19.5 PRESET COMPENSATION (Cycle 452, DIN/ISO: G452, option).....</b>             | <b>546</b> |
| Cycle run.....  | 546        |
| Please note while programming:.....   | 548        |
| Cycle parameters.....   | 549        |
| Adjustment of interchangeable heads.....  | 551        |
| Drift compensation.....   | 553        |
| Logging function.....   | 555        |



|  |            |
|--|------------|
| <b>20 Touch Probe Cycles: Automatic Tool Measurement.....</b>                      | <b>557</b> |
| <b>20.1 Fundamentals.....</b>  | <b>558</b> |
| Overview.....  | 558        |
| Differences between Cycles 31 to 33 and Cycles 481 to 483.....                     | 559        |
| Setting machine parameters.....  | 560        |
| Entries in the tool table TOOL.T.....  | 562        |
| <b>20.2 Calibrate the TT (Cycle 30 or 480, DIN/ISO: G480).....</b>                 | <b>564</b> |
| Cycle run.....   | 564        |
| Please note while programming:.....  | 564        |
| Cycle parameters.....  | 564        |
| <b>20.3 Calibrating the wireless TT 449 (Cycle 484, DIN/ISO: G484).....</b>        | <b>565</b> |
| Fundamentals.....  | 565        |
| Cycle run.....   | 565        |
| Please note while programming:.....  | 565        |
| Cycle parameters.....  | 565        |
| <b>20.4 Measuring tool length (Cycle 31 or 481, DIN/ISO: G481).....</b>            | <b>566</b> |
| Cycle run.....   | 566        |
| Please note while programming:.....  | 567        |
| Cycle parameters.....  | 567        |
| <b>20.5 Measuring tool radius (Cycle 32 or 482, DIN/ISO: G482).....</b>            | <b>568</b> |
| Cycle run.....   | 568        |
| Please note while programming:.....  | 568        |
| Cycle parameters.....  | 569        |
| <b>20.6 Measuring tool length and radius (Cycle 33 or 483, DIN/ISO: G483).....</b> | <b>570</b> |
| Cycle run.....   | 570        |
| Please note while programming:.....  | 570        |
| Cycle parameters.....  | 571        |



|                                 |            |
|---------------------------------|------------|
| <b>21 Tables of Cycles.....</b> | <b>573</b> |
| <b>21.1 Overview.....</b>       | <b>574</b> |
| Fixed cycles.....               | 574        |
| Turning cycles.....             | 576        |
| Touch probe cycles.....         | 577        |