

ONE-TOUCH IGF-L

OSP7000L/700L

OPERATION GUIDE (3rd Edition)

Pub. No. 3869-E-R1 (LE32-036-R3) July 1995

OSP OPERATION MANUAL



ONE-TOUCH IGF-L

OSP7000L/700L

OPERATION GUIDE (3rd Edition)

Pub. No. 3869-E-R1 (LE32-036-R3) July 1995

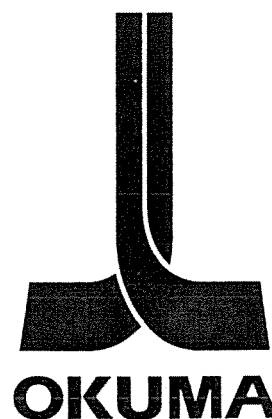



TABLE OF CONTENTS

	<u>PAGE</u>
SECTION 1 ONE-TOUCH IGF OPERATION	1
1. Machining Method Definition	1
2. Three Operation Procedures	3
3. Changing the Automatic Determination Rule	5
4. Tool Data and Prior Tool Designation	8
5. Material Data	10
6. Process Determination Conditions and Parameter Setting	11
7. Machining Shape and Blank Material Shape in the Machining Process	13
SECTION 2 ONE-TOUCH IGF OPERATION EXAMPLES	14
1. Example 1 (two-touch course)	16
2. Example 2 (two-touch course)	22
3. Example 3 (two-touch course)	28
4. Example 4 (two-touch course)	35
5. Example 5 (two-touch course)	43
6. Example 6 (two-touch course)	53
7. Example 7 (two-touch course)	60
8. Example 8 (interactive course)	69
9. Example 9 (two-touch course: two-saddle specification)	79
10. Example 10 (two-touch course: two-saddle specification)	86
11. Example 11 (1st/2nd Process Batch Creation: One-Touch IGF Course)	98
12. Supplement (Part Program Output Example)	104


	<u>PAGE</u>
SECTION 3 HOW TO USE PROCESS DETERMINATION CONDITIONS	109

1. Prior Tool Designation	112
---------------------------------	-----


(1) When Tools with Different Tool Angle and Edge Angle are Registered	114
--	-----

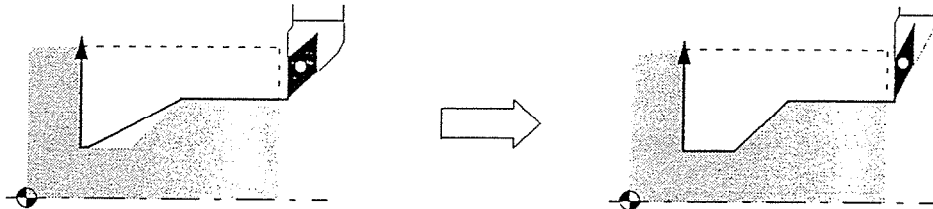


(2) When Tools with Different Holder Diameter are Registered	115
--	-----

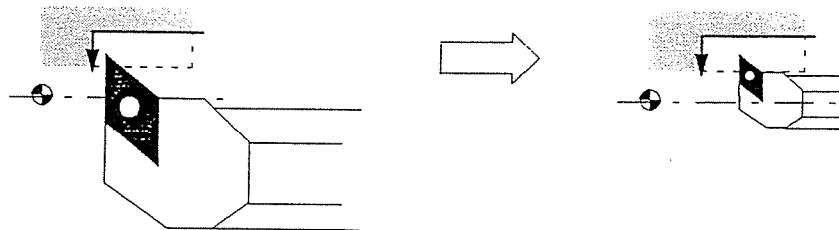


(3) When Tools with Different Tool Width are Registered	116
---	-----

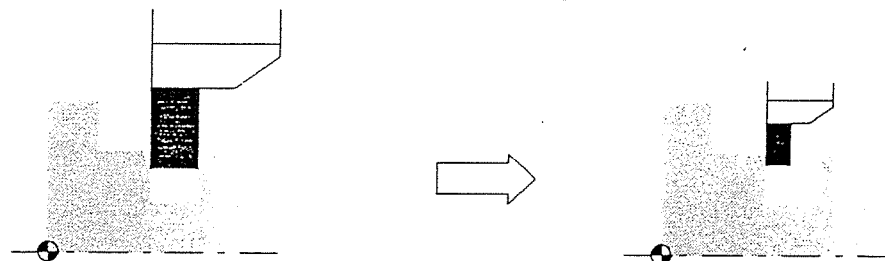






(4) When Drills with Different Drill Diameter are Registered	117
--	-----






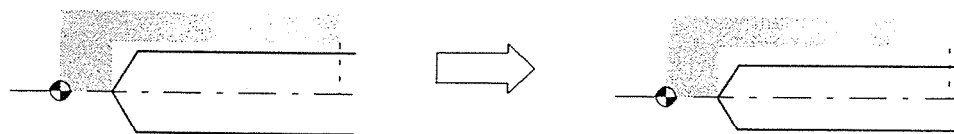


(5) When ID Machining in Which only a Drill is Used is Present	118
--	-----

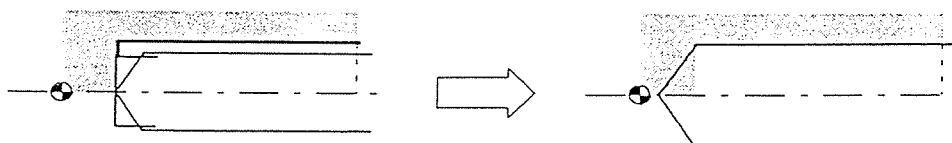


	<u>PAGE</u>
2. FACE/LONG DECIDING DATA	119
(1) Changing From LONG to FACE in the Roughing Cycle	120
(2) Changing From FACE to LONG in the Roughing Cycle	122
(3) Process Division in the Roughing Cycle (LONG → FACE + LONG)	123
(4) Process Division in the Roughing Cycle (FACE → FACE + LONG)	125
(5) Process Integration in the Roughing Cycle (FACE + LONG → LONG)	126
(6) Process Integration in the Roughing Cycle (FACE + LONG → FACE)	127

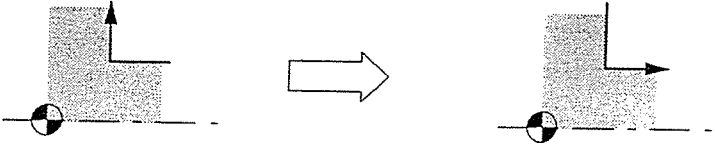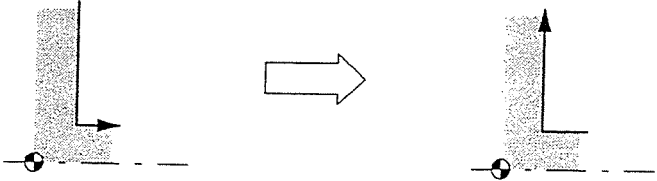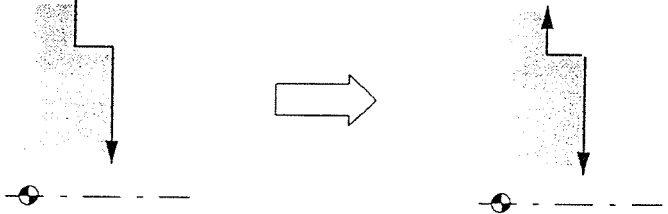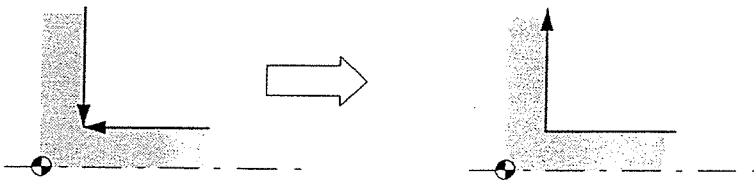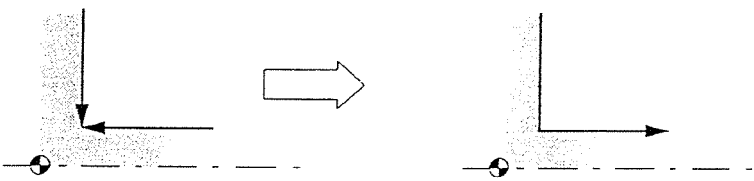	<u>PAGE</u>
(7) Changing From LONG to FACE in the Finishing Cycle	128
	
(8) Changing From FACE to LONG in the Finishing Cycle	130
	
(9) Process Division in the Finishing Cycle (FACE → FACE + LONG)	131
	
(10) Process Integration in the Finishing Cycle (FACE + LONG → LONG)	132
	
(11) Process Integration in the Roughing Cycle (FACE + LONG → FACE)	133
	
(12) To Carry Out Single-process Machining Either by a Longitudinal Machining Process or by an End Face Machining Process	134
- To always select a longitudinal machining process for the roughing process - To always select an end face machining process for the roughing process - To always select a longitudinal machining process for the finishing process - To always select an end face machining process for the finishing process	

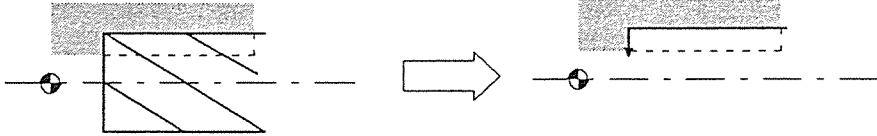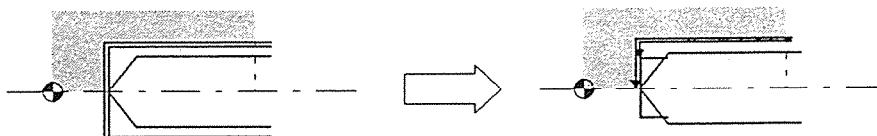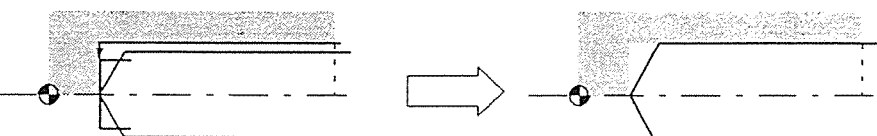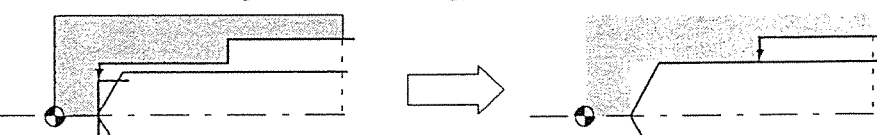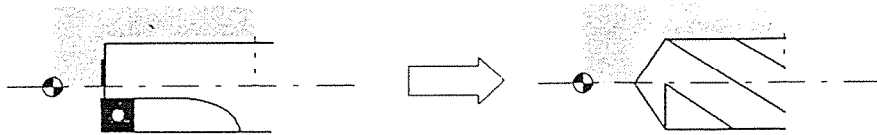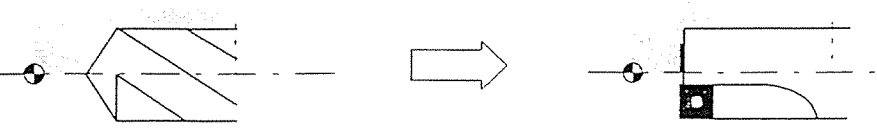
	<u>PAGE</u>
3. Inside Machining Data	140
(1) Changing the Tool to be Used from an Endmill to a Boring Bar for Through-hole Machining	141
	
(2) Changing the Tool to be Used from an Endmill to a Boring Bar for Blind-hole Machining	142
	
(3) ID Machining Using Only a Drill (no other machining process than drilling) ..	143
	
(4) ID Machining Using Only a Drill (other machining process is carried out in addition to drilling for ID machining)	144
	
(5) Changing the Type of Drill (carbide drill → HSS drill)	145
	
(6) Changing the Type of Drill (HSS drill → carbide drill)	146
	
(7) To Machine the Workpiece Using either Only a Carbide Drill or Only a HSS drill	147

PAGE


- (8) Changing the Centering Tool 148

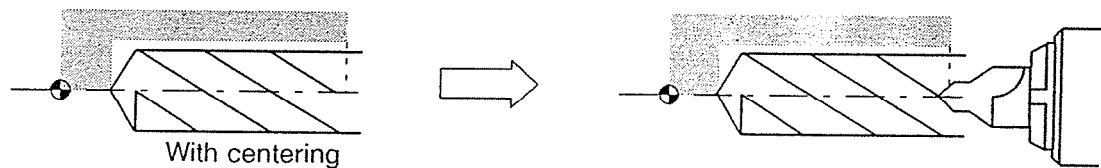

- (9) Designating Whether or not Centering is Carried Out
(HSS drill: with centering → HSS drill: without centering) 149

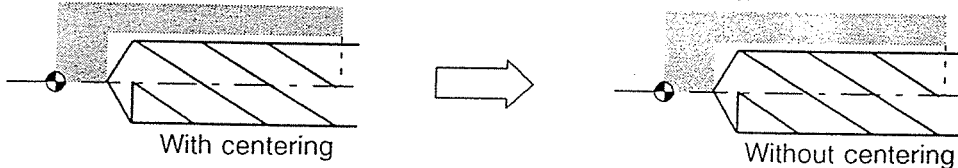


- (10) Designating Whether or not Centering is Carried Out
(carbide drill: without centering → HSS drill: with centering) 150

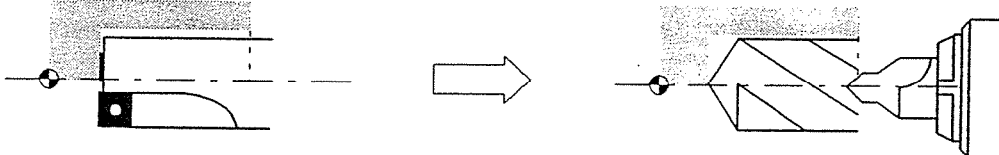


- (11) Designating Whether or Not Centering is Always Carried out 151

- (12) Designating Whether or not Drilling is Omitted 152

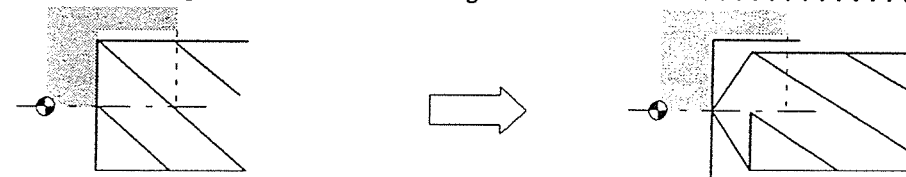

- (13) Changing from Drilling to ROUGH O. FACE ↓ 153

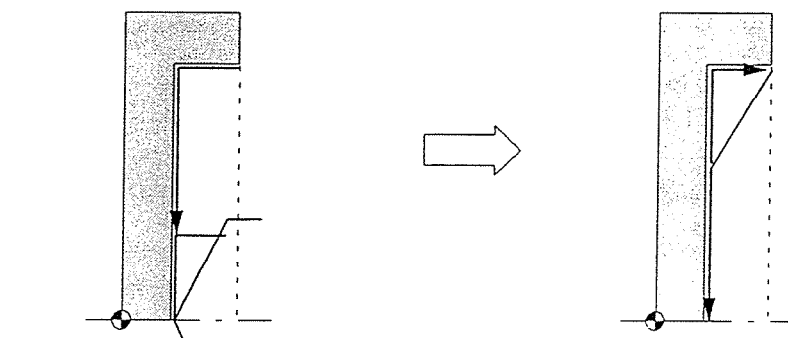

- (14) Mechanism to Determine that a Boring Bar can not be Used for Machining 154
(15) Mechanism to Determine the Drill Diameter 155
(16) Mechanism to Determine the Type of Drill 156
(17) Mechanism to Determine Whether or not Centering is Executed 157
(18) Mechanism to Omit Drilling 158

	<u>PAGE</u>
4. Shape/Tool Position Data	159
(1) Variation of Automatic Process Determination Output According to the Setting at ROUGH SHAPE OUTPUT(0 = OFFSET, 1 = SHIFT) (machining shape in the roughing process)	161
(2) Variation of Automatic Process Determination Output According to the Setting at ROUGH SHAPE OUTPUT(0 = OFFSET, 1 = SHIFT) (surface roughness)	163
(3) Variation of Automatic Process Determination Output According to the Setting at ROUGH SHAPE OUTPUT(0 = OFFSET, 1 = SHIFT)	165
SECTION 4 QUESTIONS AND ANSWERS TO THE ONE-TOUCH IGF	166
Q1 : What must be checked before beginning with actual machining?	166
Q2 : The “chucking impossible” error occurs when automatic process determination is attempted.	170
Q3 : The “remained uncut area” error occurs when automatic process determination is attempted.	172
Q4 : When automatic process determination was executed, a “Remaining Uncut Area (straight tool)” error was activated at the concave area. Can the process be created anyway if a tool is used which can handle the cutting?	175
Q5 : Is it possible to cut the descending portion without using a tool for reverse-direction cutting?	177
Q6 : The tool registered as tool data cannot be selected.	182
Q7 : Is it possible to recess the workpiece in the OD turning process (ROUGH OD←. FIN. OD←, etc.)?	185
Q8 : Is it possible to carry out drilling after the ROUGH O.FACE ↓ process? (changing the machining sequence by changing the machining sequence parameter)	187
Q9 : Points to be taken care of in the finishing process when the final shape has a very small step.	189
Q10: How can cutoff be executed?	190
Q11: Points to be taken care of when machining a stepped shape.	193
Q12: Is it possible to cut the workpiece using a straight tool?	196
Q13: Is it possible to cut the workpiece using a button tool?	197
Q14: What is the “cutting position (CUT PT CP)”?	199

	<u>PAGE</u>
Q15: What is the clearance set at the dimension parameter?	200
Q16: Is it possible not to retract the tool in the X-axis positive direction during approaching and retracting motions in the ID longitudinal machining processes (ROUGH ID← and FIN. ID←)?	201
Q17: How to cut the single groove, wide groove, or V-groove.	203
Q18: How to judge the groove to be a single groove or a wide groove.	205
Q19: How is the grooving tool width determined?	206
Q20: Is it possible to use the same tool for both the rough grooving process and the finish grooving process?	210
Q21: How is the thread cutting process created in automatic process determination?	211
Q22: How is the ID thread shape defined?	215
Q23: How is the tap shape in turning defined?	216
Q24: How are automatic chamfers generated? How is the surface roughness of automatic chamfers defined?	218
Q25: How to create a new machining process in the process edit mode by making use of the existing machining process	220
Q26: Is it possible to change the cutting direction with ease?	221