
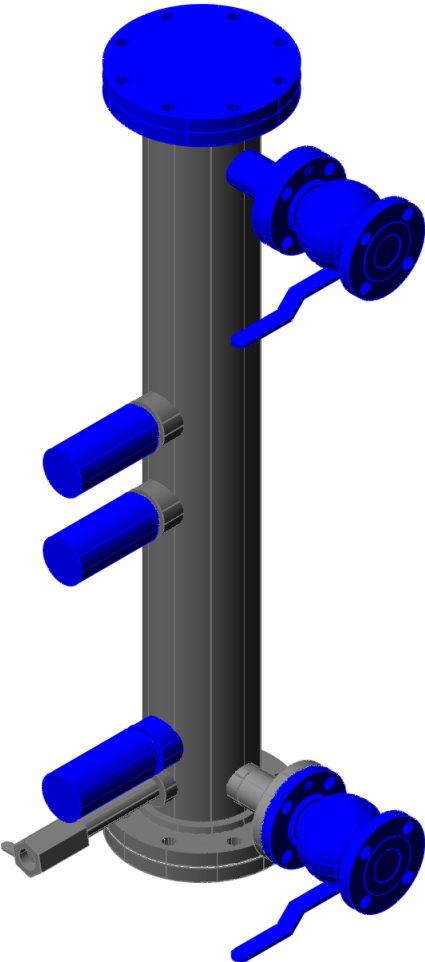


TAG	SIZE	TYPE	DESC
N1	2"	150# RFSO	LOWER FLOAT CHAMBER (EXISTING)
N2	2"	150# RFSO	UPPER FLOAT CHAMBER (NEW)
C1	1"	3000# HC	FLOAT CHAMBER DRAIN (EXISTING)
C2	2"	3000# HC	PUMP OFF (NEW)
C3	2"	3000# HC	PUMP ON (EXISTING)
C4	2"	3000# HC	HIGH LEVEL SHUT DOWN (EXISTING)
MW	20"		MAN WAY

NOTES:
1) ALL ITEMS IN BLUE ARE NEW
2) CUT DOWN EXISTING FLOAT CHAMBER AS SHOWN
3) ADD N2 AND C3 AS SHOWN
4) LEVEL CONTROLLER INSTALLED IN FIELD
5) TWO ISOLATION VALVES REQ, 2" 150# REG PORT.
6) C3 AND C4 ARE EXISTING, IF THE LOCATION IS NOT SATISFACTORY
NEW HALF COUPLING CAN BE INSTALLED.

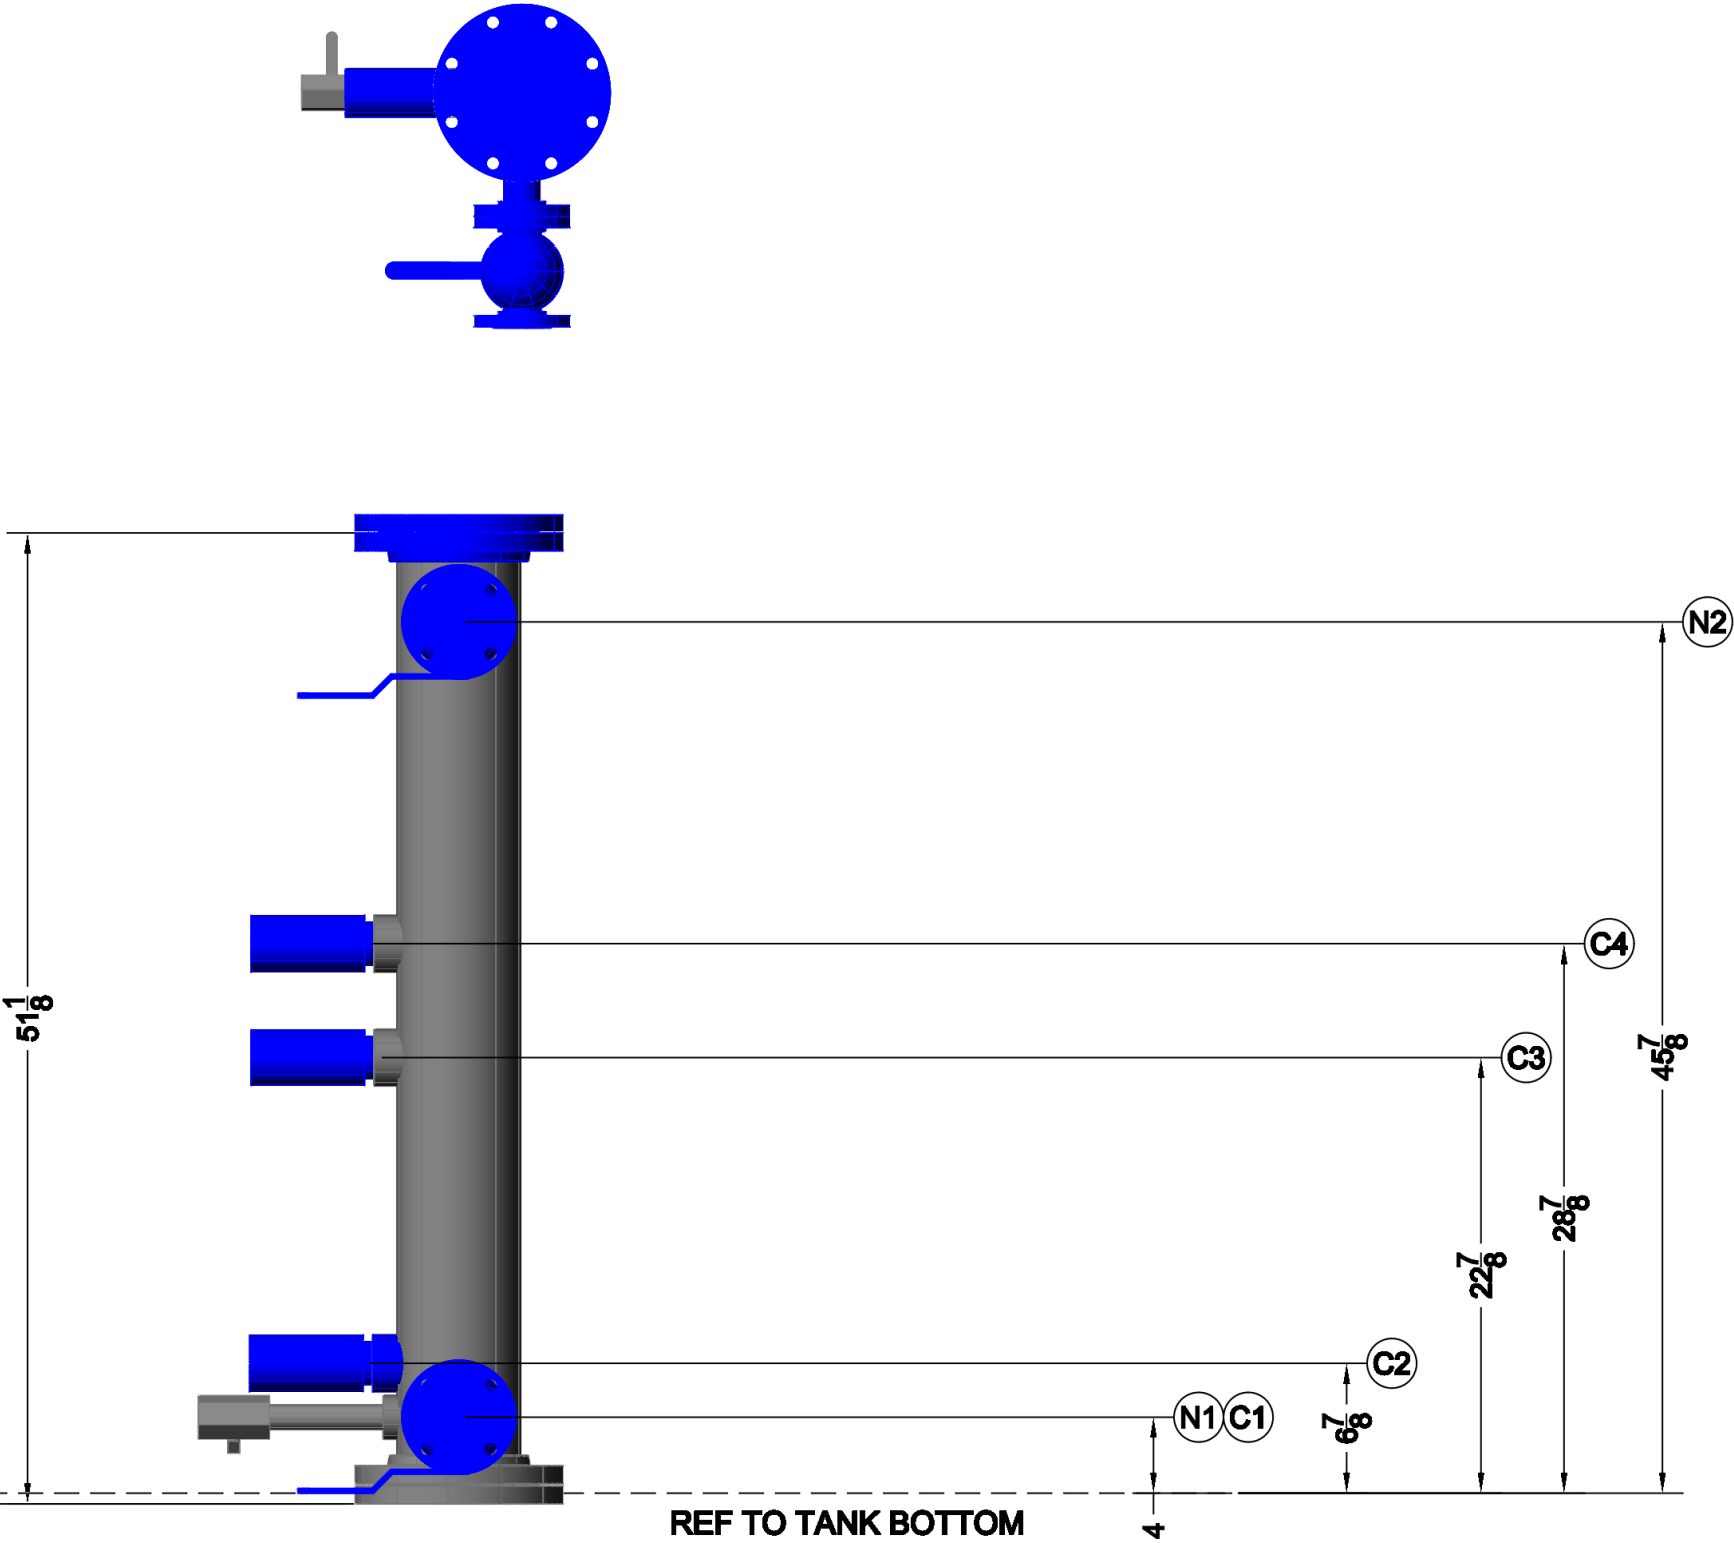

				 RARE OILFIELD SERVICES 502 MITCHELL DRIVE SE REDCLIFF, ALBERTA, T0J 2P0	RARE EQUIPMENT #		DRAWING TITLE		FILE NAME		
					15780- FLARE KNOCK OUT DRUM		15780- FLARE KNOCK OUT DRUM FLOAT CHAMBER MODIFICATION		15780 FLOAT CHAMBER		
A	MODIFICATION OF ORIGINAL FLOAT CHAMBER				KH	2026/09/10			LAYOUT NAME		
REV	DESC				BY	DATE			SHT 1		
REVISIONS									REVISION		
						DATE		DRAWN BY		REVISION DATE	
						SEPT 10, 26		K HOBMAN		A	