

**MT / PT INSPECTION REPORT**

SLICK INSPECTION LTD.  
2038-12th AVE NW  
Medicine Hat, AB, T1C 2A7  
PH: 403-527-9854  
FAX: 403-527-9867  
office@slickinspection.com

Technician Sign:



Technician Certification:

**JOHN MARTIN**  
CGSB Level II RT MT PT  
SNT-TC-1A Level II RT MT PT  
REG. #27301

Assistant:

Date:  
Client:

DEC. 4, 2025

Location:

**RARE OILFIELD**

Client Rep Signature:

**RARE OILFIELD SHOP**

Upon approval/acceptance by the Contractor the liability for the accuracy of final product becomes responsibility of the Contractor

**Invoice #:**

**JM25433**

**JM25433-M1**

Report #:

1 of 4

Page:

Acceptance Code:

ASME Sec.VIII, Div. 1 2023-UW 51

Specification:

MT-Rev.9

Procedure:

MT 2 - Wet Visible, Black On White

Technique:

RARE OILFIELD

Contractor:

A.F.E. #:

Code. #:

P.O. #:

Project:

Job. #:

**FIRE TUBE INSPECTION**

**FIRE TUBE:**



**NAME PLATE:**



PERFORMED MAGNETIC PARTICLE INSPECTION ON ALL WELDS OF THE ABOVE FIRETUBE. FOUND MULTIPLE INDICATIONS AS RECORDER IN REPORT.

Equipment & Consumables Used	Flourescent>	Black/White>	✓	Aerosol>	✓	Visible>	✓	Dry>	Puffer>
MT 2: Magnavis White Contrast Paint: WCP-2 / Magnavis Black Partical Suspension: 7HF		Calibration Block: West. Instruments S/N:2997 Cal Verified to 10lb Daily		Continuous AC Current Mag Lead Time: 10 Seconds LED Flash light>	✓	Sentential Yoke: MP-A-2L S/N: MP4083		Light Meter:XR-1000 Spectronics S/N:1752289 Cal Date: May 31,2025 Min Light Intensity: ≥ 100 FC Visible	

**MT / PT INSPECTION REPORT**

SLICK INSPECTION LTD.  
2038-12th AVE NW  
Medicine Hat, AB, T1C 2A7  
PH: 403-527-9854  
FAX: 403-527-9867  
office@slickinspection.com

Technician Sign:



Date:

Client:

DEC. 4, 2025

Technician Certification:

**JOHN MARTIN**  
CGSB Level II RT MT PT  
SNT-TC-1A Level II RT MT PT  
REG. #27301

Assistant:

Location:

Client Rep Signature:

**RARE OILFIELD**

**RARE OILFIELD SHOP**

**Invoice #:**

**JM25433**

**JM25433-M1**

2 of 4

Page:

Acceptance Code:

ASME Sec.VIII, Div. 1 2023-UW 51

Specification:

MT-Rev.9

Procedure:

MT 2 - Wet Visible, Black On White

Technique:

RARE OILFIELD

Contractor:



A.F.E. #:

Code. #:

P.O. #:

Project:

Job. #:

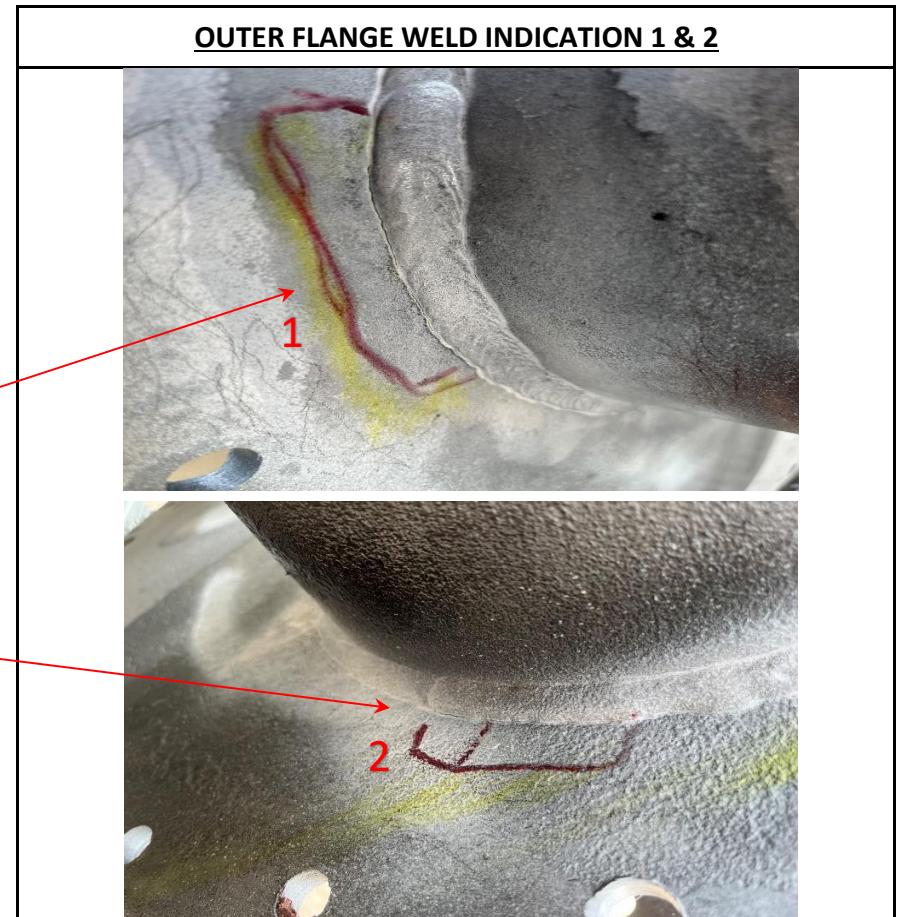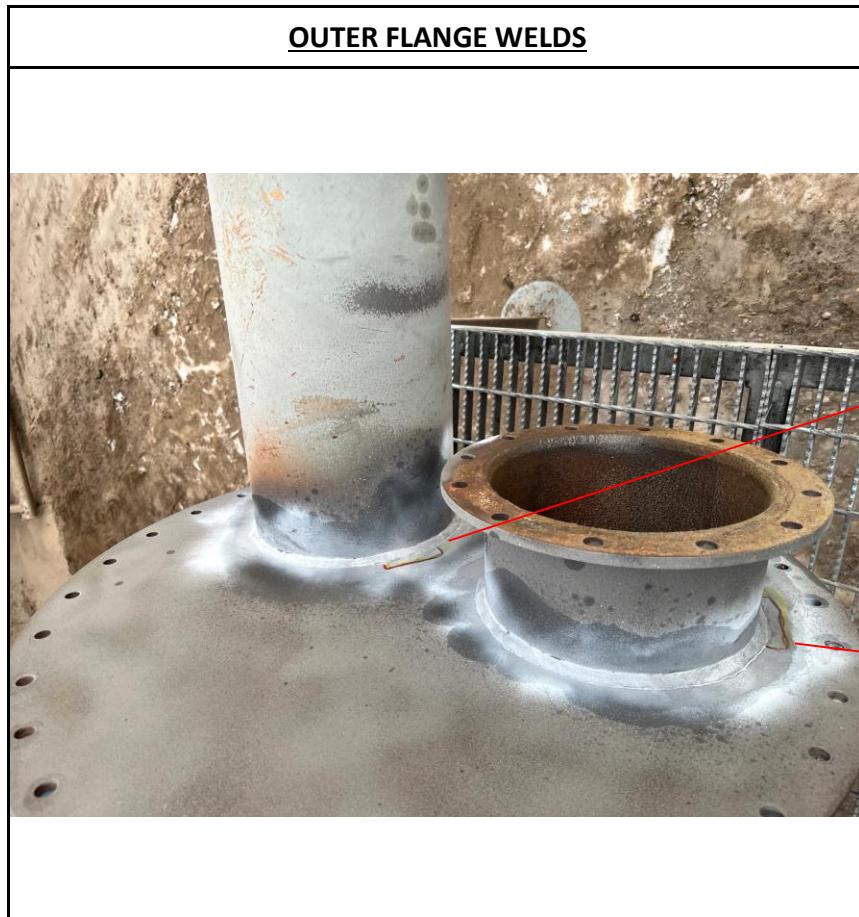

Information On Above: ↓ Material:> Carbon Steel Surface Condition:> Sand Blasted

LINEAR INDICATIONS ON TOE OF WELDS.

Information On Above: ↓ Material:> Carbon Steel Surface Condition:> Sand Blasted

INDICATION 1 - 9CM LINEAR TOE INDICATION.  
INDICATION 2 - 10CM LINEAR TOE INDICATION.

**MT / PT INSPECTION REPORT**

SLICK INSPECTION LTD.  
2038-12th AVE NW  
Medicine Hat, AB, T1C 2A7  
PH: 403-527-9854  
FAX: 403-527-9867  
office@slickinspection.com

Technician Sign:



Technician Certification:

**JOHN MARTIN**  
CGSB Level II RT MT PT  
SNT-TC-1A Level II RT MT PT  
REG. #27301

Assistant:

Date:  
Client:

DEC. 4, 2025

Location:

**RARE OILFIELD**

Client Rep Signature:

**RARE OILFIELD SHOP**

**Invoice #:**

**JM25433**

**JM25433-M1**

3 of 4

Report #:

Page:

Acceptance Code:

ASME Sec.VIII, Div. 1 2023-UW 51

Specification:

MT-Rev.9

Procedure:

MT 2 - Wet Visible, Black On White

Technique:

RARE OILFIELD

Contractor:

A.F.E. #:

Code. #:

P.O. #:

Project:

Job. #:

Upon approval/acceptance by the Contractor the liability for the accuracy of final product becomes responsibility of the Contractor

**INNER FLANGE WELDS**



**INNER FLANGE WELD INDICATION 3**



Information On Above: ↓ Material:> Carbon Steel Surface Condition:> Sand Blasted

LINEAR INDICATION ON TOE OF WELD.

Information On Above: ↓ Material:> Carbon Steel Surface Condition:> Sand Blasted

INDICATION 3 - 18CM LINEAR TOE INDICATION

**MT / PT INSPECTION REPORT**

SLICK INSPECTION LTD.  
2038-12th AVE NW  
Medicine Hat, AB, T1C 2A7  
PH: 403-527-9854  
FAX: 403-527-9867  
office@slickinspection.com

Technician Sign:



Date:

Client:

DEC. 4, 2025

Technician Certification:

**JOHN MARTIN**  
CGSB Level II RT MT PT  
SNT-TC-1A Level II RT MT PT  
REG. #27301

Location:

Client Rep Signature:

**RARE OILFIELD**

Assistant:

Upon approval/acceptance by the Contractor the liability for the accuracy of final product becomes responsibility of the Contractor

**RARE OILFIELD SHOP**

**Invoice #:**

**JM25433**

**JM25433-M1**

4 of 4

Report #:

Page:

Acceptance Code:

ASME Sec.VIII, Div. 1 2023-UW 51

Specification:

MT-Rev.9

Procedure:

MT 2 - Wet Visible, Black On White

Technique:

RARE OILFIELD

Contractor:



A.F.E. #:

Code. #:

P.O. #:

Project:

Job. #:

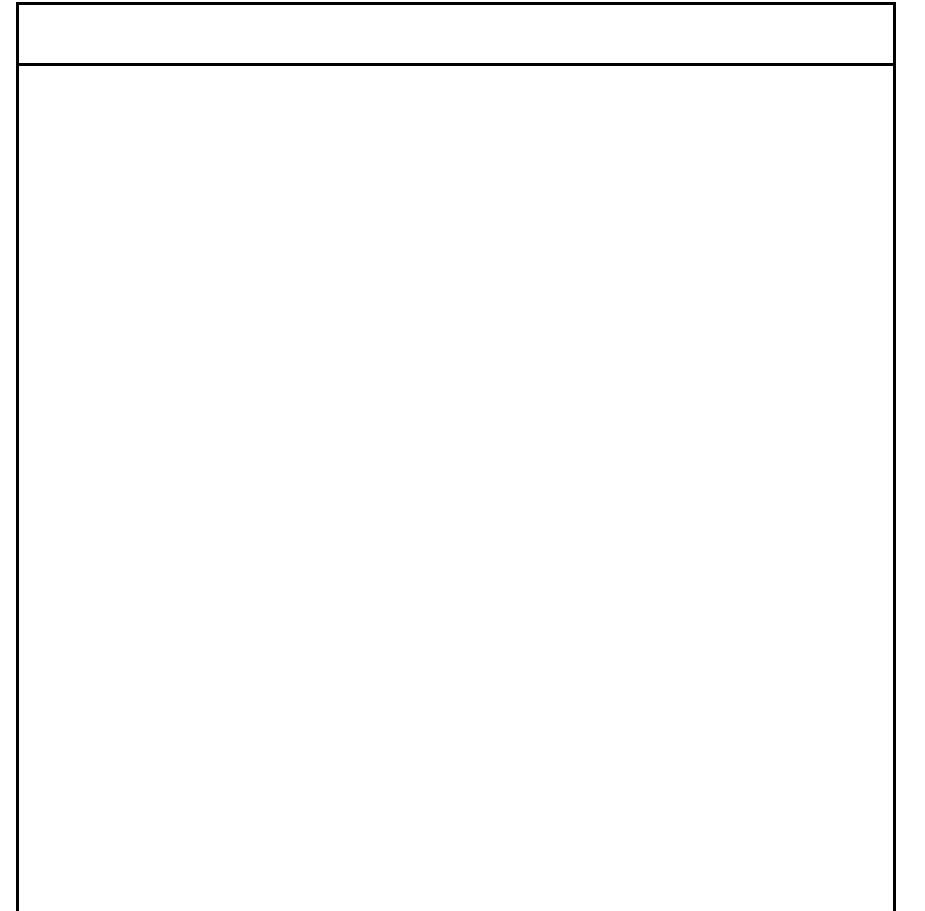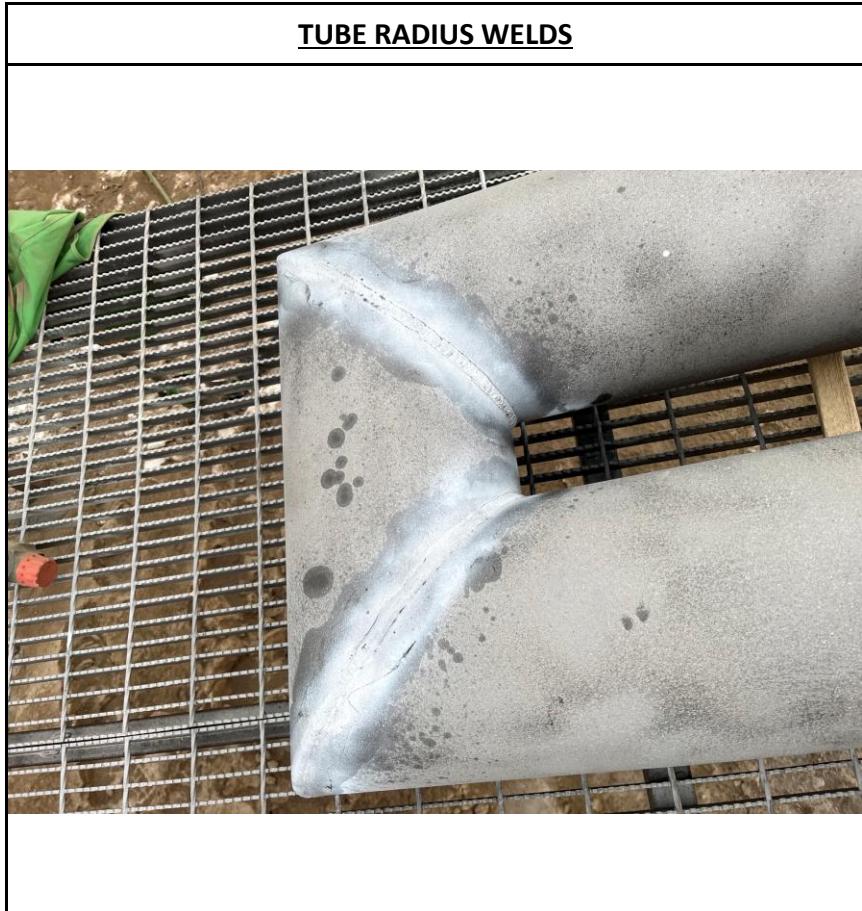

Information On Above: ↓ Material:> Carbon Steel Surface Condition:> Sand Blasted

Information On Above: ↓ Material:> Surface Condition:>

NO RELEVANT INDICATIONS AT TIME OF INSPECTION.