



ULTRASONIC THICKNESS INSPECTION REPORT

Invoice #:**JM26261**

Report #:

JM26261-U1

Page:

1 of 3

Technician Sign:

Date:

AUG.31/2026

Client:

RARE OILFIELD

Acceptance Code:

Client Information

Specification:

Integrity Survey

Procedure:

UT-1 Rev.2

Technique:

UT - Thickness

Contractor:

A.F.E.#:

Code.#:

P.O.#:

Project:

Job.#:

SLICK INSPECTION LTD.
2038-12th AVE NW
Medicine Hat, AB, T1C 2A7
PH: 403-527-9854
FAX: 403-527-9867
office@slickinspection.com

Technician Certification:

JOHN MARTIN
CGSB Level II RT MT PT
SNT-TC-1A Level II RT MT PT
REG. #27301

Location:

RARE OILFIELD SHOP

Client Rep Signature:

Assistant:

Upon approval/acceptance by the Contractor the liability for the accuracy of final product becomes responsibility of the Contractor

75 BBL FKOD THICKNESS INSPECTION

VESSEL:



NAME PLATE:



PERFORMED RANDOM THICKNESS READINGS ON THE ABOVE VESSEL AT CLIENTS REQUEST.

Equipment, Calibrations & Consumables Used

Instrument Make:	AlphaGage+, Ser: 000128	Range Of Verification: 0.1" - 0.5"	Calibrated On: AUG.31/2026	Cable Length: 3 Feet	Cable Type: Coaxial	Test Method: Thickness> Lamination>	Couplant: Sonotech Soundsafe
Transducer Settings:	Sonatest Probe	Model: DK525	Calibrated On: AUG.31/2026	Angle: 0°	Frequency: 5 MHz	Size: 5 / .25"	Reference & Scan /
Calibration Block:	Stainless 5 Step Wedge .100" - .500"	Block Serial #: S/N 3142 24	Calibrated On: AUG.31/2026	Reference Reflector: Backwall		Reference %FSH 100%	Range Setting 1.0 Inches



ULTRASONIC THICKNESS INSPECTION REPORT

Invoice #:

JM26261

Report #:

JM26261-U1

Page:

2 of 3

Acceptance Code:

Client Information

Specification:

Integrity Survey

Procedure:

UT-1 Rev.2

Technique:

UT - Thickness

Contractor:

A.F.E.#:

Code.#:

P.O.#:

Project:

Job.#:

Technician Sign:

Date:

AUG.31/2026

Client:

RARE OILFIELD

Location:

RARE OILFIELD SHOP

Client Rep Signature:

Technician Certification:

JOHN MARTIN


CGSB Level II RT MT PT
SNT-TC-1A Level II RT MT PT
REG. #27301

Assistant:

Upon approval/acceptance by the Contractor the liability for the accuracy of final product becomes responsibility of the Contractor

SLICK INSPECTION LTD.
2038-12th AVE NW
Medicine Hat, AB, T1C 2A7
PH: 403-527-9854
FAX: 403-527-9867
office@slickinspection.com

Area Surface Readings: ↓			Nominal Wall Thickness:> N/A			Average Thickness Reading:> N/A			Area Surface Readings: ↓			Nominal Wall Thickness:> .375"			Average Thickness Reading:> .420"		
Location #:	Thickness Min:	Thickness Max:	Location #:	Thickness Min:	Thickness Max:	Location #:	Thickness Min:	Thickness Max:	Location #:	Thickness Min:	Thickness Max:	Location #:	Thickness Min:	Thickness Max:	Location #:	Thickness Min:	Thickness Max:
UT-1	.530"	.549"	UT-6	.386"	.411"	UT-11	.400"	.412"	UT-16	.426"	.438"						
UT-2	.363"	.380"	UT-7	.255"	.276"	UT-12	.414"	.420"									
UT-3	.282"	.300"	UT-8	.546"	.553"	UT-13	.425"	.429"									
UT-4	.375"	.406"	UT-9	.519"	.536"	UT-14	.417"	.421"									
UT-5	.247"	.264"	UT-10	.235"	.242"	UT-15	.419"	.422"									

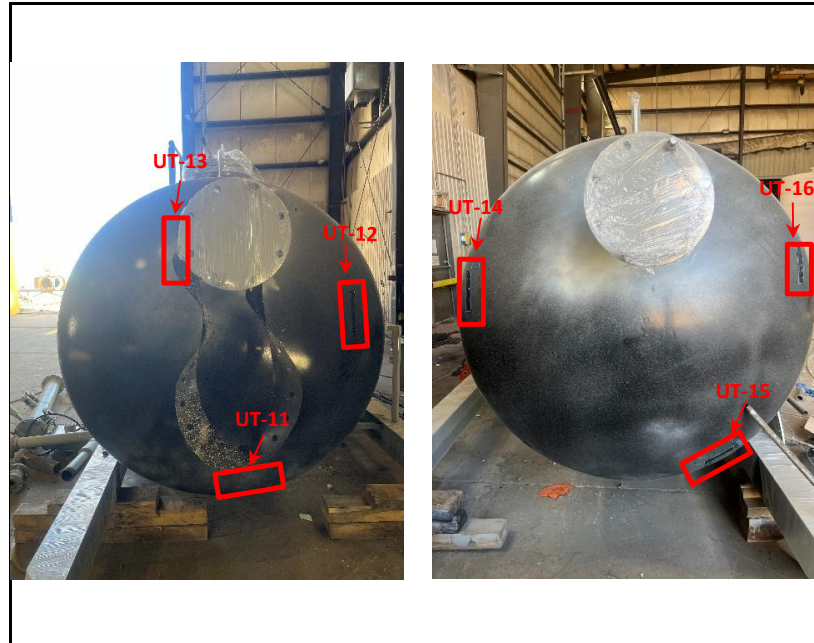

Information On Above: ↓ Material:> Carbon Steel Surface Condition:> Coated

NOZZEL INSPECTIONS

Information On Above: ↓ Material:> Carbon Steel Surface Condition:> Coated

VESSEL HEADS INSPECTION



ULTRASONIC THICKNESS INSPECTION REPORT

Invoice #:

JM26261

Report #:

JM26261-U1

Page:

3 of 3

Acceptance Code:

Client Information

Specification:

Integrity Survey

Procedure:

UT-1 Rev.2

Technique:

UT - Thickness

Contractor:

A.F.E.#:

Code.#:

P.O.#:

Project:

Job.#:

Technician Sign:

Date:

AUG.31/2026

Client:

RARE OILFIELD

Location:

RARE OILFIELD SHOP

Client Rep Signature:

Technician Certification:

JOHN MARTIN

CGSB Level II RT MT PT

SNT-TC-1A Level II RT MT PT


REG. #27301

Assistant:

Upon approval/acceptance by the Contractor the liability for the accuracy of final product becomes responsibility of the Contractor

SLICK INSPECTION LTD.
2038-12th AVE NW
Medicine Hat, AB, T1C 2A7
PH: 403-527-9854
FAX: 403-527-9867
office@slickinspection.com

Area Surface Readings: ↓			Nominal Wall Thickness:>	.313"	Average Thickness Reading:>	.344"	Area Surface Readings: ↓			Nominal Wall Thickness:>	Average Thickness Reading:>
Location #:	Thickness Min:	Thickness Max:	Location #:	Thickness Min:	Thickness Max:	Location #:	Thickness Min:	Thickness Max:	Location #:	Thickness Min:	Thickness Max:
UT-17	.316"	.320"	UT-22	.329"	.337"						
UT-18	.347"	.351"	UT-23	.325"	.344"						
UT-19	.360"	.368"	UT-24	.365"	.375"						
UT-20	.365"	.371"	UT-25	.321"	.330"						
UT-21	.336"	.345"	UT-26	.335"	.347"						



Information On Above: ↓ Material:> Carbon Steel Surface Condition:> Coated

Information On Above: ↓ Material:> Surface Condition:>

VESSEL SHELL INSPECTION